



Service Bulletin

Bulletin No.: 19-NA-178

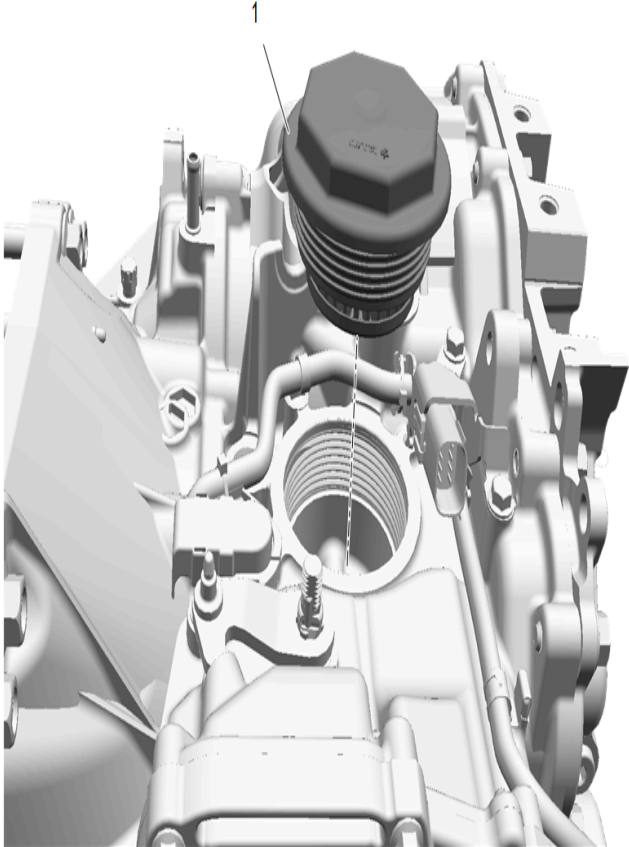
Date: August, 2019

TECHNICAL

Subject: Transmission Fluid Leak on Driver Side Near Front Wheel

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Malibu	2019	2019				CVT250 Automatic (RPO MRG)

Involved Region or Country	North America, Israel
Condition	Some customers may comment that a fluid is leaking on the driver side inboard of the wheel. – The fluid may have a greenish tint.
Cause	This condition may be caused by the transmission fluid filter assembly not sealing properly.

<p>Correction</p>	
	<p>5206407</p>
	<p>Inspect the filter assembly (1) for a fluid leak around it. ⇒ If fluid has been verified to be leaking from the filter assembly, replace the filter assembly.</p>

Service Procedure

Refer to *Transmission Fluid Filter Replacement* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	FILTER, A/TRNS FLUID	24290959	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8462110	Transmission Fluid Filter Replacement	Use Published Labor Operation Time

Version	1
Modified	Released August 15, 2019

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
 TECHNICIAN
 CERTIFICATION