# Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

SQUEAK NOISE FROM REAR BRAKES DURING LIGHT BRAKING

Bulletin No.: 04-004/19

Last Issued: 09/16/2019

# APPLICABLE MODEL(S)/VINS

## **US Spec.:**

2013-2016 CX-5 vehicles with VINs lower than JM3KE\*\*\*\*\*921726 (produced before Dec. 21, 2016) 2017-2019 CX-5

## Mexico Spec.:

2013-2017 CX-5 vehicles with VINs lower than JM3KE\*\*\*\*\*921726 (produced before Dec. 21, 2016) 2018-2019 CX-5

### DESCRIPTION


Some vehicles may exhibit a squeak noise from the rear brakes while braking lightly. The squeak noise may occur more frequently when driving at slow speeds. The noise is caused by poor contact between the guide plate and the mounting support.

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

- 1. Verify the customer concern.
- 2. Remove the rear brake pads according to the instructions on MGSS online (REAR BRAKE DISC PAD REMOVAL/INSTALLATION).
- 3. Apply dual adhesive tape (8 pieces per vehicle) between the guide plate (4) and the mounting support (5) according to the "APPLYING DUAL ADHESIVE TAPE" procedure below.

Page 1 of 6

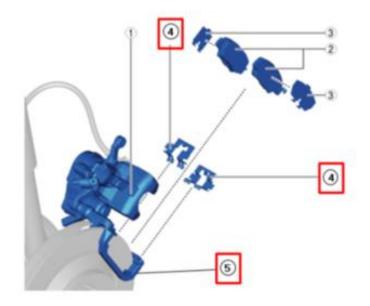


- 1 Rear brake caliper
- 2 Disc pad
- 3 Shim
- 4 Guide plate
- 5 Mounting support

# **APPLYING DUAL ADHESIVE TAPE:**


1. Degrease and clean the guide plates and contact surfaces of the both mounting supports with brake cleaner.

Page 2 of 6

Bulletin No.: 04-004/19

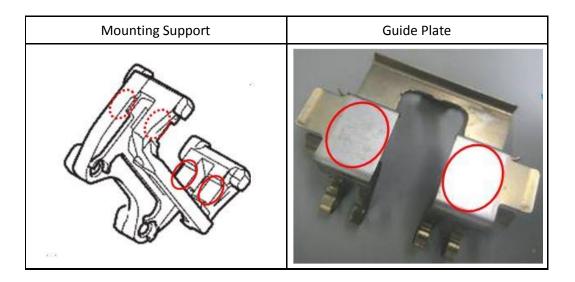

2. Peel off the red release film (1) and the dual adhesive tape (2) from the release paper (3).

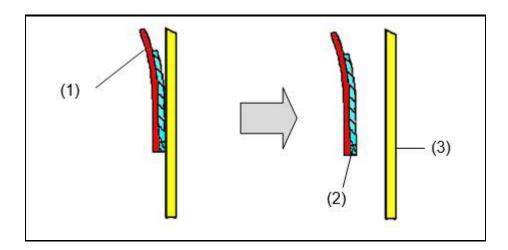


NOTE:Do not touch the sticky surface of the dual adhesive tape.


3. Apply the dual adhesive tape to the contact surfaces of the guide plates as shown below.

NOTE:Do not apply the dual adhesive tape beyond the contact surfaces of the guide plates.

Page 3 of 6

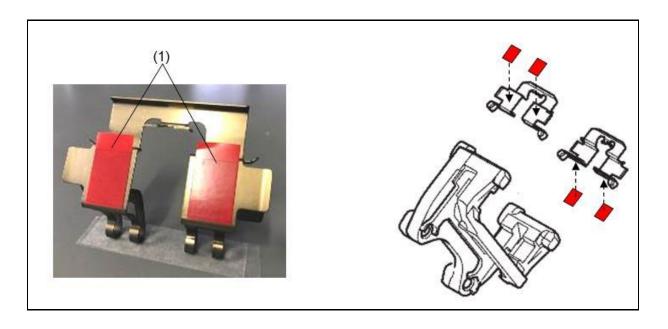


4. Peel off the red release film from the dual adhesive tape.

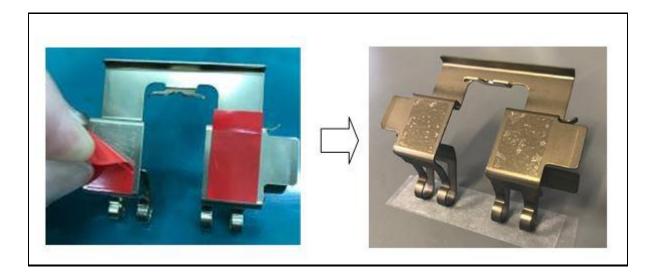

5. Reinstall the guide plates to both mounting supports.

**NOTE:**When reinstalling the guide plates, do not allow a gap between the guide plate and mounting support.

# Page 4 of 6

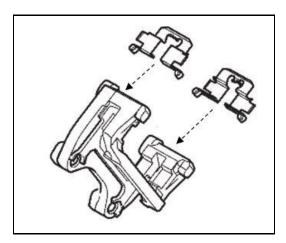

- 6. Reinstall the rear brake pads according to the instructions on MGSS online (REAR BRAKE DISC PAD REMOVAL/INSTALLATION).
- 7. Step on the brake pedal several times to verify the brakes operate properly before moving the vehicle.
- 8. Verify the repair.

Bulletin No.: 04-004/19

## PARTS INFORMATION

Part N	Number	Description	Qty.	Note
D6Y13	33 <b>2</b> 3XA	Dual Adhesive Tape Set	1	Contains 8 pieces

## WARRANTY INFORMATION

#### NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А		
Symptom Code	35		
Damage Code	97		
Part Number Main Cause	KAY0-26-28X		
Part Quantity	0		
Labor Operation Number / Labor Hours	XXR8GARX / 0.5 Hr.		
Labor Operation Number / Labor Hours	Includes: Applying dual adhesive tape		

Page 5 of 6

Bulletin No.: 04-004/19	Last Issued: 09/16/2019
l l	

NOTE: Claim Dual Adhesive tape set (D6Y1-33-23XA, Qty. = 1) as a related part.

# Page 6 of 6