# Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:	Su	bj	e	ct	:
----------	----	----	---	----	---

A/C BLOWS WARM AIR DUE TO EVAPORATOR LEAK

Bulletin No.: 07-003/19

Last Issued: 09/10/2019

# **BULLETIN NOTES**

This bulletin supersedes the previously issued bulletin(s) listed below: The changes are noted in Red.

Previous TSBs:	Date(s) Issued:
07-004/17	04/18/2017 and 09/12/2017
07-006/17	05/22/2017
07-006/16	12/12/2016

## APPLICABLE MODEL(S)/VINS

## US Spec.:

2016-2019 CX-3 vehicles with VINs JM1 DK \*\*\*\*\*\* 103784 through 432950 (produced from June 01, 2015 through December 7, 2018)

## Canada Spec.:

2016-2019 CX-3 Canada vehicles with VINs JM1 DK \*\*\*\*\*\* 100037 through 432950 (produced from March 09, 2015 through December 7, 2018)

## Mexico Spec.:

2016-2019 CX-3 vehicles with VINs JM1 DK \*\*\*\*\*\* 103784 through 432950 (produced from June 01, 2015 through December 7, 2018)

2016-2017 Mazda2 vehicles with VINs 3MD DJA \*\*\*\*\* 100050 through 109656 (produced from December 19, 2014 through December 4, 2016)

# DESCRIPTION

Some customers may complain about warm air from the climate control vents. This may be caused by improper brazing (A) of the evaporator (B), causing a refrigerant leak from the joint between the tubes (C) and the header (D).

#### Page 1 of 5



Customers having this concern should have their vehicle repaired using the following repair procedure.

# **REPAIR PROCEDURE**

1. Verify customer concern.

2. Use a dealer supplied manifold gauge tool to check the A/C refrigerant charge. Refer to MGSS online: (REFRIGERANT PRESSURE CHECK). Is the A/C refrigerant charge low?

- Yes Go to step 3.
- No This Service Information is not applicable. Refer to MGSS online: (NO COOL AIR [FULL-AUTO AIR CONDITIONER]).

3. Use a dealer supplied UV leak detection tool. Is there a trace of fluorescent liquid at the A/C unit drain hose end?

NOTE: UV fluorescent leak detection dye is added at the factory.

- Yes Go to step 4.
- No This Service Information is not applicable. Refer to MGSS online: (NO COOL AIR [FULL-AUTO AIR CONDITIONER]).

4. Replace the A/C evaporator. Refer to MGSS online: (A/C UNIT REMOVAL/INSTALLATION).

**NOTE:** When replacing the evaporator, add compressor oil of approximately 40 ml {40 cc, 1.4 fl oz}. Refer to MGSS online: (REFRIGERANT CHARGING).

5. Verify repair.

#### Page 2 of 5

## SPECIAL SERVICE TOOL(S)

Dealer Supplied		
	A/C Manifold Gauge	UV leak detection

## PARTS INFORMATION

Part Number	Description	Qty.	Notes
DD2F-61-J10A	Evaporator	1	O-Rings for Expansion Valve
			come with the new evaporator
D09W-68-162	Trim Clip	2	
			Non-reusable parts
9YA0-11-003A	Bolt, Steering Wheel	1	
B455-32-099B	Bolt, Intermediate Shaft, Lower	1	
D10J-32-099	Bolt, Intermediate Shaft, Upper	1	
9YA0-20-682	Bolt, Dashboard	2	
BBM4-61-J17	O-Ring, Cooler Pipe, Low	1	
GJ6A-61-J19	O-Ring, Cooler Pipe, High	1	
Z6E6-15-182	Clip, Heater Hose	2	
5555-FG-002	A/C Refrigerant	As needed	
D1Y1-61-K39	Compressor Oil (250 ml)	1	1 compressor oil repairs 6 vehicles (40 ml each)

Page 3 of 5

Bulletin No.: 07-003/19	Last Issued: 09/10/2019

## **Replacement Part Location**



#### NOTE:

- O-Rings for Expansion Valve come with the new evaporator.
- Modified part can be distinguished by its black marking at the cap as shown below.

Page 4 of 5



# WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

CX-3 / Mazda2
A
59
9G
DD2F-61-J10A
1
5555-CP-OIL
12
(Qty. 12 = \$12 reimbursement)
XXMASARX / 3.2 Hrs.
XXMATXRX / 0.7 Hrs.

## NOTE:

- Claim the replacement parts as related parts.
- Claim the A/C compressor oil using 5555-CP-OIL, which will reimburse you for 1/6 of the can (1 can repairs 6 vehicles).
- Claim the A/C refrigerant by entering the applicable part number and the quantity used as related part.

#### Page 5 of 5