

68 Noises from dash panel around MMI display

68 19 23 2056298/1 September 27, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7	2019	All	Not Applicable

Condition

Customer states:

 Noises can be heard from the dash panel when driving on poor roads. The noise comes from the area near the MMI display.

Technical Background

The dash panel trim can cause noise at the contact points.

Production Solution

Improvement made to the trim installation process in production.



Service

The following material is needed for the repair:

- Felt strips 533 867 910A.
- Remove the trim strip of the dash panel and stick the felt adhesive tape on the areas marked with yellow circles.

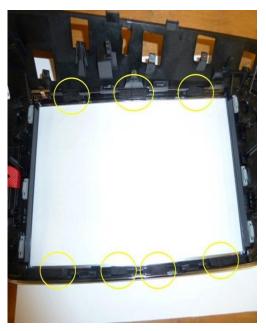


Figure 1. Apply felt strips to the circled areas.



The felt strips shown in Figure 1 and 2 must be stuck on and folded back behind the clip.



Figure 2. Close-up of Figure 1.



Figure 3. Apply felt strips to the circled areas.





Figure 4. Apply felt strips to the circled areas.

3. Reassemble the trim following the Elsa repair manual instructions.

Warranty

Claim Type:	• 110 up to 6 Months/6,000 Miles.			
	1AM over 6 Months/6,000 Miles.			
	If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.			
Service Number:	7058			
Damage Code:	0020			
Labor Operations:	Remove and install dash panel trim	7016 1999	80 TU	
	Modify dash panel trim	7016 4999	20 TU	
Diagnostic Time:	GFF	No allowance	0 TU	
	Road test prior to the service procedure	0121 0002	10 TU	
	Road test after the service procedure	0121 0004	10 TU	
Claim Comment:	As per TSB #2056298/1			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.					
Part Number	Part Description	Quantity			
533867910A	Felt Strip	01			
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA			

Additional Information

All parts and service references provided in this TSB (2056298) are subject to change and/or removal.

©2019 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.