



GROUP
Electrical

MODEL
**2020MY
Telluride (ON)**

NUMBER
PS627

DATE
September 2019




TECHNICAL OPERATIONS

SUBJECT: INOPERATIVE LICENSE PLATE LAMP AND/OR
LIFTGATE HANDLE SWITCH


This Pitstop provides information regarding concerns of inoperative license plate lamp(s) and/or tailgate handle switch on some 2020MY Telluride (ON) vehicles.

Inspect the connector R28 for bent or backed out pin(s). If the connector pin(s) are found to be damaged, repair as needed. Once repaired, check for correct operation of the license plate tail lamps and liftgate handle switch. If no damage is found on the connector, proceed with normal diagnosis.

To access the liftgate switch R28 connector: Remove the liftgate trim by referring to the "Liftgate → Liftgate Trim → Repair procedures" chapter in the applicable Shop Manual on KGIS.

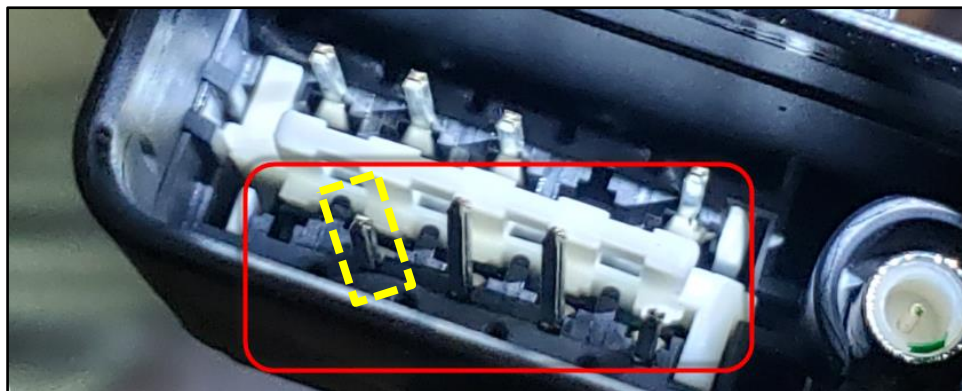

The sample image above shows a bent and backed out pin outlined in yellow.

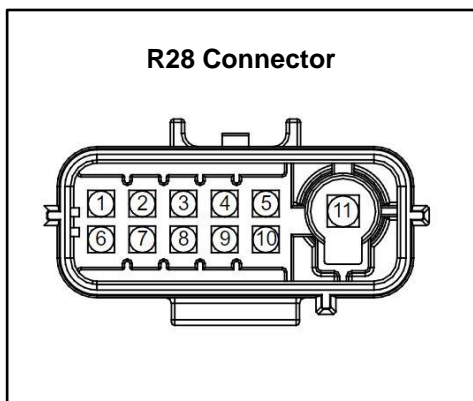

Pin	Color	Function
1	G/B	Rear View Camera (shield)
2	G/O	Rear View Camera (ground)
3	B	Tailgate Handle Switch (ground)
4	-	-
5	B	License Lamp (ground)
6	-	-
7	Y	Rear View Camera (power)
8	Gr/B	Tailgate Handle Switch
9	R	License Lamp (LH)
10	Y/B	License Lamp (RH)
11	W	Rear View Camera (coaxial)