

SERVICE PROCEDURE

**19515
SEPTEMBER 2019**

SUBJECT: EMISSIONS RECALL
Navistar has decided that a defect which relates to engine emissions exists in certain International® LT® Series trucks built 01 June 2018 thru 29 March 2019 with 2018 and 2019 model year International® A26 engine.

DEFECT DESCRIPTION

Replacement of the Charge Air Cooler (CAC) outlet hose to prevent a potential increase of particulate matter emissions from a potential hose failure.

MODELS INVOLVED

This Emissions Recall involves certain International® LT® Series model trucks built 01 June 2018 thru 29 March 2019 with 2018 and 2019 model year International® A26 engines.

ELIGIBILITY

This procedure applies ONLY to vehicles marked in the International® Service PortalSM with Safety Recall 19515. Also complete any other open campaigns listed on the Service Portal at this time.

PARTS INFORMATION

Part Number	Part Description	Quantity
6129021C3	Hose; CAC Outlet	1

SERVICE PROCEDURE

WARNING! To prevent personal injury and / or death, or damage to property, park vehicle on hard flat surface, turn the engine off, set the parking brake and install wheel chocks in front of and behind the wheels to prevent the vehicle from moving in either direction.

WARNING! To prevent personal injury and / or death, always wear safe eye protection when performing vehicle maintenance.

WARNING! To prevent personal injury and / or death, or damage to property, allow engine / vehicle components to cool before servicing.

WARNING! To prevent personal injury and / or death, or damage to property, keep flames, sparks or other heat sources away from vehicle and do not smoke while servicing the vehicle's batteries. Batteries expel gases which may cause an explosion resulting in personal injury / death, or damage to property, avoid contact with any heat sources.

1. Park vehicle on flat surface.
2. Shift transmission to Park or Neutral and set parking brake.
3. Turn vehicle ignition to Key OFF position.
4. Install wheel chocks.
5. Unlatch and open hood.
6. Remove and replace Charge Air Cooler (CAC) outlet hose; refer to appropriate technician manual for detailed instructions.
7. Inspect removed CAC outlet hose for a tear near bend of hose.
 - a. If removed CAC outlet hose is not torn, proceed to Step 9.
 - b. If removed CAC outlet hose is torn, proceed to Step 8.
8. Follow FCAP code found in Health Report for additional steps that are required.
9. Close and latch hood.
10. Remove wheel chocks.

Additional Requirements for Dealers and Customers Operating in California

NOTE: The following step is required only for dealers and customers operating in the state of California.

11. After completing this recall, dealer must fill out salmon-colored Proof of Correction certificate and provide a copy to customer.
 - a. Use either Figure 1 (certificate to color print on white paper) or Figure 2 (certificate to print on salmon-colored paper) to print DMV certificates.

Vehicle Emission Recall - Proof of Correction					
License Number	Make	Year Model	Body Type	Vehicle Identification Number	
Manufacturer			Recall Number		
The above described vehicle has been repaired, modified and/or equipped with new emission control devices to meet applicable California Emission Control Laws.					
Dealer's		Address, City, State			
		Dealership's Authorized			
		☒			
Return this certificate to DMV <u>only</u> when required - otherwise retain for your records.					

0000047743

Figure 1. DMV Certificate, Salmon (Print on 8.5 x 11 inch White Paper).

Vehicle Emission Recall - Proof of Correction					
License Number	Make	Year Model	Body Type	Vehicle Identification Number 	
Manufacturer _____			Recall Number _____		
The above described vehicle has been repaired, modified and/or equipped with new emission control devices to meet applicable California Emission Control Laws.					
Dealer's _____		Address, City, State _____			
Dealership's Authorized X					
Return this certificate to DMV <u>only</u> when required - otherwise retain for your records.					

0000047729

Figure 2. DMV Certificate, White (Print on 8.5 x 11 inch Salmon Paper).

END OF SERVICE PROCEDURE

LABOR INFORMATION

Operation Number	Description	Time
A40-19515-1	Replace CAC Outlet Hose	0.4 hr
A40-T1	Follow FCAP for Additional Steps Required	Per Time Punches

CAMPAIGN IDENTIFICATION LABEL

Each vehicle corrected in accordance with this campaign must be marked with a CTS-1075 Campaign Identification Label.

Complete the label and attach on a clean surface next to the vehicle identification number (VIN) plate.

DO NOT REMOVE

INTERNATIONAL

Campaign No. _____

VIN _____

Eng.# _____

COMPLETED

Service Location Code # _____

DO NOT REMOVE

ADMINISTRATIVE / DEALER RESPONSIBILITIES

WARRANTY CLAIMS

Warranty claim expense is to be charged to Warranty. Claims are to be submitted in the normal manner, making reference to Safety Recall 19515.

Section 7 of the Warranty Policy and Procedures Manual contains further information related to the submission and processing of AFC / Recall claims.

As with all claim submissions, items acquired locally must be submitted in the “Other Charges” tab. The cost of any bulk items (such as a bag of cable tie straps, roll of wire, barrel of oil, or tube of silicone) should be prorated for the cost of the individual pieces / amount used during each repair.

GROUP	NOUN	C	WARR.	TP	PAD

GROUP — Enter number ←

NOUN — Leave blank ←

C (CAUSE) — Enter either 1, 2, 3. (See below)

- 1. Inspected (No repair required).
- 2. Inspected and repaired.
- 3. Defective part from parts stock.

WARRANTY — (Warranty Code) Enter 40. ←

TYPE PART — Enter P for type part causing failure. ←

PAD — Enter 100 ←

0000047910

UNITED STATES AND POSSESSIONS

The National Traffic and Motor Vehicle Safety Act, as amended, provides that each vehicle that is subject to a vehicle recall campaign must be adequately repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after a tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not adequately repaired within 60 days, the owner may be entitled to replacement with an identical or reasonable equivalent vehicle at no charge, or to a refund of the purchase price less a reasonable allowance for depreciation.

Dealers must correct all vehicles subject to this campaign at no charge to the owner, regardless of mileage, age of vehicle, or ownership, from this time forward.

Dealers should proceed immediately to make necessary correction to units in inventory. All inventory vehicles subject to this recall campaign must be corrected prior to sale, transfer or delivery. If vehicles have been sold or transferred and you are in receipt of Customer Notification Letters and Authorization for Recall Service cards for those vehicles, the transfer location or customer must be notified immediately from your dealer location.

Dealers must make every effort to promptly schedule an appointment with each owner to repair his or her vehicle as soon as possible. However, consistent with the customer notification, dealers are expected to complete the repairs on the mutually agreed upon service date.

Dealers involved in the recall process will be furnished a listing of owner names and addresses to enable them to follow up with owners and have the vehicles corrected. Use of this listing must be limited to this campaign because the list may contain information obtained from state motor vehicle registration records, and the use of such motor vehicle registration data for purposes other than this campaign is a violation of law in several states.

CANADA

Dealers must correct all vehicles subject to this campaign at no charge to the owner, regardless of mileage, age of vehicle, or ownership, from this time forward.

Dealers should proceed immediately to make necessary correction to units in inventory. All inventory vehicles subject to this recall campaign must be corrected prior to sale, transfer or delivery. If vehicles have been sold or transferred and you are in receipt of Customer Notification Letters and Authorization for Recall Service cards for those vehicles, the transfer location or customer must be notified immediately from your dealer location.

Dealers must make every effort to promptly schedule an appointment with each owner to repair his or her vehicle as soon as possible. However, consistent with the customer notification, dealers are expected to complete the repairs on the mutually agreed upon service date.

Dealers involved in the recall process will be furnished a listing of owner names and addresses to enable them to follow up with owners and have the vehicles corrected. Use of this listing must be limited to this campaign because the list may contain information obtained from state motor vehicle registration records, and the use of such motor vehicle registration data for purposes other than this campaign is a violation of law in several states.

EXPORT

Export Distributors should proceed immediately to make necessary correction to units in inventory. All inventory vehicles subject to this recall campaign must be corrected prior to sale, transfer or delivery. If vehicles have been sold or transferred and you are in receipt of Customer Notification Letters and Authorization for Recall Service cards for those vehicles, the transfer location or customer must be notified immediately from your distributor location.

Export Distributors are to submit warranty claims in the usual manner making reference to this recall number.

Export Distributors are expected to provide full cooperation and follow-up with respect to this important subject matter. If you have any questions or need further assistance, please contact the Regional Service Manager at your regional office.

NAVISTAR, INC.