

SSM 48157 - 2002-2008 F-Super Duty/F-150/Mark LT - Vehicle Security Module (VSM) Programming

Some 2002-2008 F-Super Duty, F-150 and Mark LT vehicles may exhibit concern during or after programming the VSM. The programming may fail or vehicle symptoms such as inoperative door locks, dome lamps, door ajar indicators or auto lamps may occur after successful programming. To ensure the VSM is configured correctly, use the Integrated Diagnostic System (IDS) scan tool and select the blue ball and socket icon in the upper left corner. Select the utility knife in the bottom left corner. Select Update/Special Function and enter "53061" in the blue box then press the tick mark. The screen will go back to the system utilities page. Navigate to the toolbox tab and run the Programmable Module Installation (PMI) on the VSM. The procedure will prompt you to manually enter the as-built into the VSM. Obtain the as-built data from PTS > OASIS > As-Built.