



# Technical Service Bulletin

---

## PSS 91 Front parking aid provides false warnings after sudden temperature change

91 19 99 2056388/1 October 7, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q8	2019 - 2020	All	With parking assistance front and rear

## Condition

### Customer states:

- After leaving a relatively cool garage compared to the outside temperature, the parking aid activates and detects “ghost” objects around the vehicle for the first couple minutes of driving.

### Workshop findings:

- No relevant DTCs are stored in the vehicle.

## Technical Background

The parking aid sensors are temperature compensated.

To suppress false or jittery temperature readings, the vehicle’s temperature sensor output is dampened.

Therefore, when transitioning from cool air (like in a cool garage) into hot air, it can take a couple minutes for the temperature sensor to catch up with the actual outside air temperature.

This means, that in those situations, the parking aid sensors are compensated to an incorrect temperature which in certain cases can cause “ghost” warnings.

## Production Solution

Not applicable.

## Service

**If the vehicle’s VIN is older than CW 50/2018 and the vehicle has not had SVM 09A042 performed yet:**

1. Please follow TSB 2053801: *91 Front parking aid provides false warnings.*
2. Retest if the update solved the customer’s concern.

### Otherwise:

1. Explain to the customer, that this behavior is due to physical limitations in the technology used.



# Technical Service Bulletin

---

2. Possible workarounds are being evaluated.
  3. Do not replace any components for this condition since this will not resolve the customer's concern.
  4. Show the customer how to deactivate the automatic activation of the parking aid system in the MMI settings in the following menu:
    - *Vehicle >> Parking Aid.*
  5. Please create a PSS record **for each concern** in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*), or through the Technical Assistance Page in Elsa.
- The automatic activation of the parking aid system and rearview camera when putting the vehicle into reverse is not affected by this setting.

## Warranty

This TSB is informational only and not applicable to any Audi Warranty.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2053801, *91 Front parking aid provides false warnings.*

All part and service references provided in this TSB (2056321) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.