

Published date: 09/6/2019

Preliminary Information

PIP5529B Stall Hesitation P0068 P0101 P0106 P0131 P0137 P0171 P0324 P0326 P0331 P0506 CV LKW LTG Loose Intake Manifold Bolts

Product Investigation Review Required

Models

| Brand: | Model: | Model Years: | VIN: | | Facina | Transmissions |
|-----------|----------|--------------|------|-----|-------------|----------------|
| | | | from | to | Engine: | Transmissions: |
| Buick | Envision | 2016 - 2017 | All | All | LCV LTG | All |
| Buick | Regal | 2014 - 2017 | All | All | LTG | All |
| Cadillac | ATS | 2013 - 2017 | All | All | LTG LCV | All |
| Cadillac | СТ6 | 2016 - 2017 | All | All | LTG | All |
| Cadillac | стѕ | 2014 - 2017 | All | All | LTG | All |
| Chevrolet | Camaro | 2016 - 2017 | All | All | LTG | All |
| Chevrolet | Colorado | 2015 - 2017 | All | All | LCV | All |
| Chevrolet | Malibu | 2013 - 2017 | All | All | LCV LKW LTG | All |
| Chevrolet | Impala | 2014 - 2017 | All | All | LCV LKW | All |
| GMC | Acadia | 2017 | All | All | LTG | All |
| GMC | Canyon | 2015 - 2017 | All | All | LCV | All |

| Involved Region or Country | North America |
|-------------------------------|---|
| Condition | In rare cases, some customers may comment that the malfunction indicator lamp is on, vehicle has a hesitation or may stall. Technicians may find any combination of diagnostic trouble codes P0068 P0101 P0106 P0131 P0137 P0171 P0324 P0326 P0331 P0506. |
| Cause | If service information does not lead to a solution, inspect the intake manifold bolts for being loose. |

Correction:

If the intake manifold bolts were loose, remove one bolt at a time and add medium strength threadlocker, torque them in sequence to the proper specification per SI. Do not replace the intake manifold gasket unless testing indicates the gasket is leaking after the bolts are torqued.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time | | |
|--|------------------------------|------------|--|--|
| 4086138 | Torque Intake Manifold Bolts | 0.4 Hr. | | |
| *This is a unique Labor Operation for Bulletin use only. | | | | |

<u>Version History</u>

| Version | 3 |
|----------|--|
| Modified | 10/18/2017 - Created on. |
| | 2/27/2018 - Updated condition, correction and added a unique labor |
| | operation. |
| | 9/5/2019 - Updated correction and added the use of threadlocker |



© 2019 General Motors. All Rights Reserved.