



Preliminary Information

PIT5688A Diagnostic Tip: Gurgle noise from Heater Core After Performing 19-NA-007

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|----------|--------------|------|-----|---------|----------------|
| | | | from | to | | |
| Chevrolet | Colorado | 2015 - 2020 | All | All | All | All |
| GMC | Canyon | 2015 - 2020 | All | All | All | All |

| | |
|-----------------------------|---|
| Involved Region or Country: | North America |
| Condition: | Gurgle noise from heater core, may persist after performing 19-NA-007 . |
| Cause: | Orientation of the filler cap versus the heater core. |

It can be difficult to remove the air from the heater core using the Vac N Fill method because the radiator cap and heater core are at about the same height. If the noise persists, raise the front of the vehicle a foot with a hoist, add 400ml coolant to the overflow bottle, remove the radiator cap. Run the engine for an hour running the throttle up to ~1500 RPM 3 or 4 times during the hour. Engineering and eSI is reviewing this condition and may replace this information with a bulletin.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation: | Description: | Labor Time: |
|------------------|-----------------------------------|-----------------|
| 4486028 | Purge Air From Heater Core | 0.4 hrs. |

Version History

| | |
|----------|--|
| Version | 2 |
| Modified | 05/20/2019 - Created on. 09/19/2019 - Updated to add the 2020 Model Year. |



GENERAL MOTORS