

Preliminary Information

PIP5678 8L90 M5U Unable To Complete Solenoid Valve Characterization With SPS After The Replacement Of The Automatic Transmission Assembly

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|-----------------|--------------|------|-----|-----------|------------------|
| | | | from | to | Eligilie. | Halisillissions. |
| Cadillac | Escalade Models | 2015 - 2017 | All | All | All | M5U |
| Chevrolet | Silverado | 2015 - 2017 | All | All | All | M5U |
| GMC | Sierra | 2015 - 2017 | All | All | All | M5U |
| GMC | Yukon Models | 2015 - 2017 | All | All | All | M5U |

| Involved Region or Country | North America |
|----------------------------|--|
| la 11.11 | Unable to complete Solenoid Valve Characterization with SPS after the replacement of the automatic transmission assembly. |
| Calice | The Solenoid Valve Characterization has been locked by General Motors Service due to a possible fluid contamination issue. |

Correction:

Complete the fluid exchange process for the vehicle you are working on outlined in TSB 18-NA-355.

Contact the Technical Assistance Center (TAC) by establishing a DCM TAC case.

Reference PIP5678 indicating that you have a transmission TUN that you cannot complete Solenoid Characterization.

Provide the TUN number in the TAC case.

The TAC case will be escalated to second level support so that the Solenoid Valve Characterization can be unlocked within one business day.

Once the Solenoid Characterization is unlocked complete the required programming.

Labor/Warranty: Use Other Labor Hours (OLH) to perform the fluid exchange and to work with TAC to the have the transmission TUN unlocked so that programming can be completed.

Only the following 9 transmission TUN numbers are affected.

| TUN | P/N |
|------------------|----------|
| LF192065UFL70004 | 24283595 |
| LF192125UJL70001 | 24283596 |
| LF192125UJL70003 | 24283596 |
| LF192125UJL70004 | 24283596 |

| LF192125UJL70005 | 24283596 |
|------------------|----------|
| LF192125UJL70006 | 24283596 |
| LF192125UJL70009 | 24283596 |
| LF192125UJL70010 | 24283596 |
| LF192135UJL70002 | 24283596 |

Parts Information

Refer to bulletin 18-NA-355 for parts information.

Warranty Information

Use Other Labor Hours (OLH) to perform the fluid exchange and to work with TAC to the have the transmission TUN unlocked so that programming can be completed. Reference PIP5678 in the warranty claim.

<u>Version History</u>

| Version | 1 | |
|----------|--------------------------|--|
| Modified | 09-23-2019 - Created on. | |



© 2019 General Motors. All Rights Reserved.