




Preliminary Information

PIT5713 SES MIL / IPC Gauges Sweep / IPC Warning Message / Reduced Engine Power / Loss Communication / DTCs U0073 U0100 U0101 u0121 U0128 U0129 U0131 U0140 U0146 U0422 U2413 P0107 P0641 C2A07 (Inspect Engine Harness)

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (new model)	2019 - 2020	All	All	4.3L LV3	All
GMC	Sierra 1500 (new model)	2019 - 2020	All	All	4.3L LV3	All

Involved Region or Country	North America
Additional Options (RPO)	With 4.3L V6 Engine RPO LV3
Condition	<p>Some customers may comment on any of the following issues:</p> <ul style="list-style-type: none">- IPC gauges sweeping while driving- Several IPC warning messages and MIL displayed- Any combination of the following DTC's: U0073 U0100 u0101 u0121 u0128 U0129 u0131 U0140 U0146 U0422 U2413 P0107 P0641 C2A07 <p>In most cases, powertrain movement will duplicate the issue, such as, shifting between drive and reverse, accelerating, braking or just driving.</p>
Cause	These concerns could be caused by the engine wiring harness rubbing on the front corner of the left hand cylinder head (1) and shorting any number of circuits to ground, see pictures below.

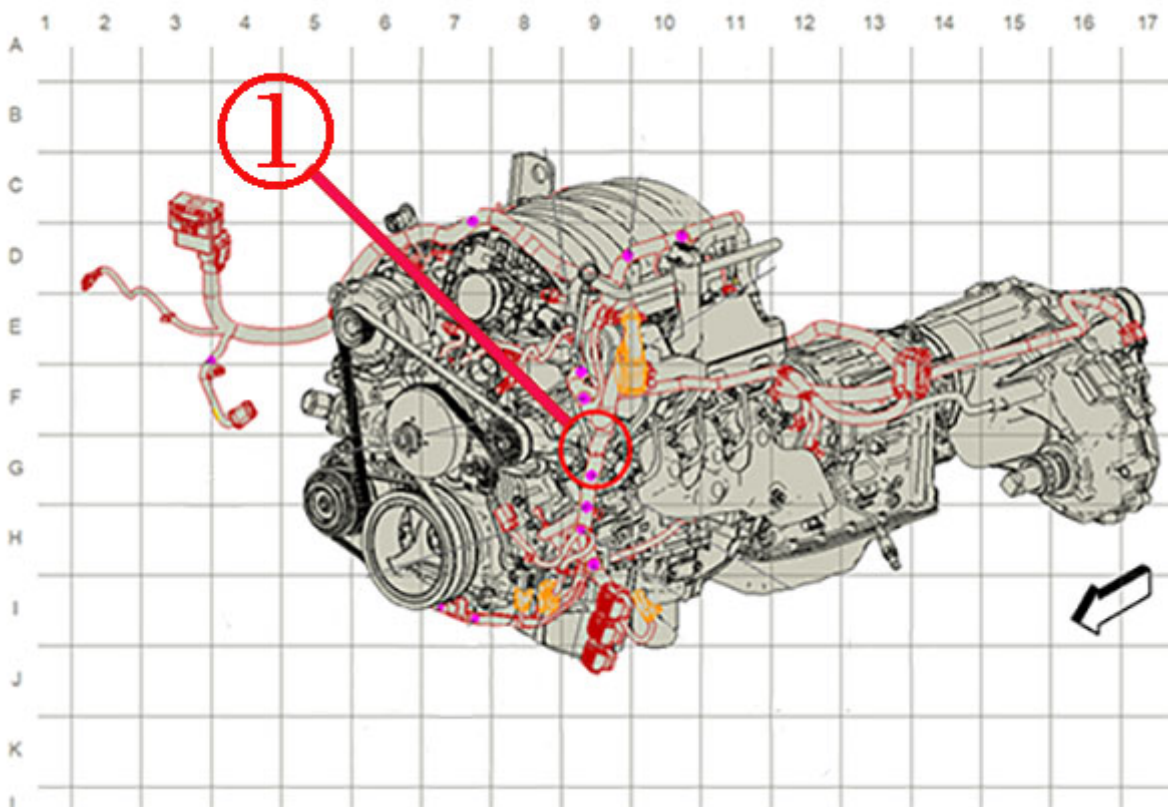



Correction:

To correct this concern, repair the damaged wiring following the SI wire-to-wire repair procedures. Once repaired, protect and reposition the engine wiring harness to prevent future harness damage.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	09/30/2019 - Created on.

