

Advanced Technical Information

Bulletin #: 1905

Part ID: 6953

6

971 Airbag Warning with High Cabin Temperature

Vehicles Affected

Model	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Panamera	2018-2019	971	N/A	N/A

Revision History

Revision	Release Date	Changes
1	September 25, 2019	Fault code descriptions added
0	April 9, 2019	Original document

Condition

The customer experiences a warning in the instrument cluster for the passenger airbag. This is usually seen when the cabin of the vehicle has high temperatures. The workshop finds a combination of one or more of the following fault codes:

- B101629 - Passenger airbag OFF indicator light - signal implausible
- B12F129 - Passenger airbag ON indicator light - signal implausible
- B151329 - Passenger airbag ON/OFF indicator lights, text lighting - signal implausible
- B151304 - Passenger airbag ON/OFF indicator lights, text lighting - faulty

Technical Background

This behavior is due to errant handling of high temperature in the overhead console (where the passenger airbag light resides).

Service Information

Porsche is aware of this issue and working to produce a bug fix. When the fix becomes available, we will update this bulletin. No advice for permanent corrective action is available at this time. Parts should not be exchanged.

Please coding the PQIS job as follows:

Cause location: 69530 Airbag control unit

Cause symptom: 1417 Overheated/too hot

Search Items

Airbag; warning; implausible; hot; roof console

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.