

**** SOLUTION ****

Title Volvo Chassis - **Model VN**, Hood Release Cable Interference; Hood Release Cable Binding, Hood Latch Tough To Pull - **Model Year 2018 And Newer**

Volvo Models


Volvo Model VN , VNL , VNM , VNR , VNX

**** SOLUTION ****

Cause For certain vehicles produced for model year 2018 and newer, the hood latch cable for the passenger side latch may be routed around a corner of the air box. This can cause the cable to bind when the hood release is pulled, and may lead to premature failure of the cable.

Solution For vehicles affected by this issue, the corner of the air box will need to be modified:

Using an appropriate tool, cut the corner off of the air box. This will allow the cable to straighten out and prevent fatigue. A diagram with approximate dimensions can be found below. The blue section is the portion that will be trimmed off:

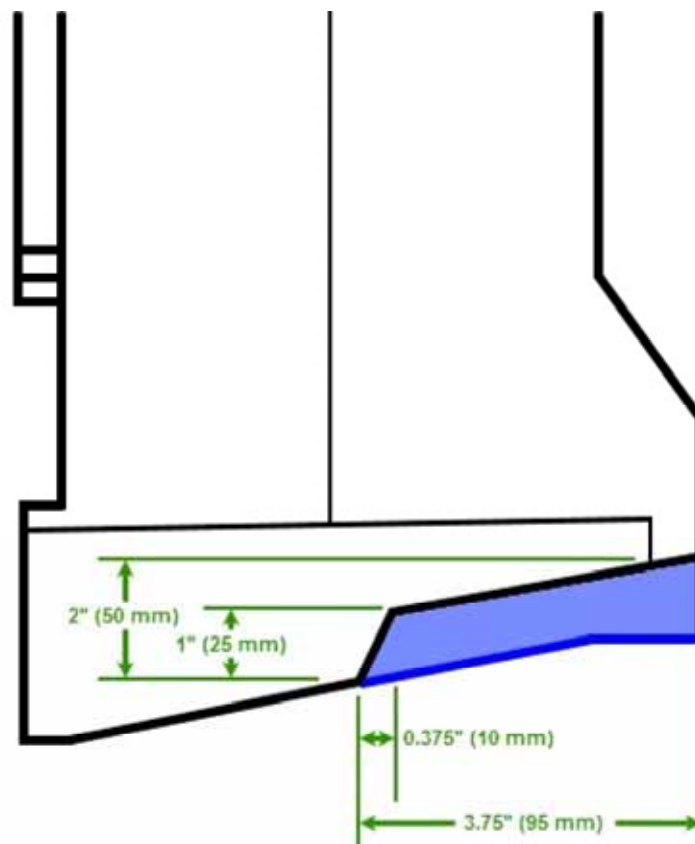

An example of an air box before and after being trimmed can be seen below:





Solution visibility	Dealer distribution
---------------------	---------------------

Function(s)/component(s) affected

Function affected	Cab Components , exterior equipment
-------------------	-------------------------------------

Function Group

Function Group	82 engine hood, front section, mudguard, foot step, platform
----------------	--

Customer effect

Main customer effect	opening/closing , locking/unlocking , visual appearance
----------------------	---

Visual appearance	fretted , wear
-------------------	----------------

Administration

Author	UT0783V
--------	---------

Dealer ID	UT0783V
-----------	---------

Last modified by	A241298
------------------	---------

Creation date	09-09-2019 20:09
---------------	------------------

Date of last update	24-09-2019 16:09
---------------------	------------------

Review date	13-01-2020 00:01
-------------	------------------

Status	Published
--------	-----------

UNCONTROLLED COPY. Printed document is for temporary use only and should not be retained.