



Service Bulletin

Bulletin No.: 19-NA-215

Date: September, 2019

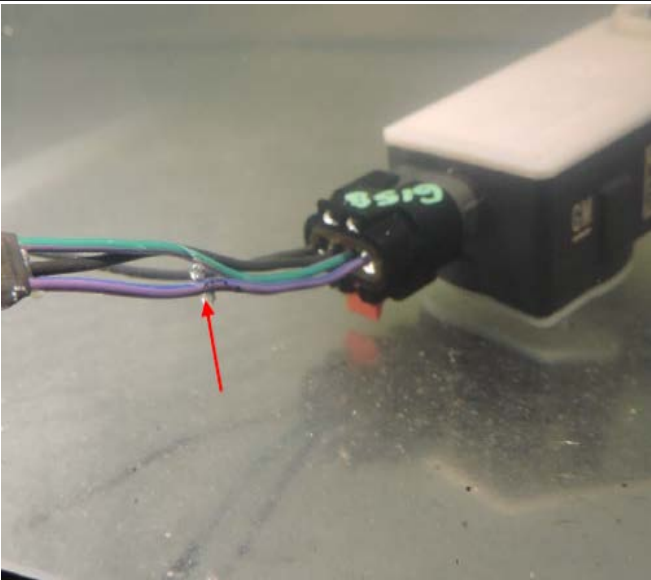
TECHNICAL

Subject: Service Engine Soon (SES) Lamp Illuminated, DTC U1345 Set.


This bulletin replaces PIT5609A. Please discard PIT5609A.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2018	2019			All	All
Chevrolet	Traverse						

Involved Region or Country	North America, N.A. Export Regions
Additional Options (RPOs)	
Condition	Some customers may comment on the Service Engine Soon (SES) lamp illuminated. Technician may find DTC U1345 – Engine Control Module LIN Bus 1 (or Bus 21), set.
Cause	The cause of the condition may be water intrusion at the upper or lower connectors of the Active Grille Air Shutter.

Correction	
-------------------	--

5405347

	
	<p>5405349</p> <p>Note: Examples of harness damage are shown in the graphics above.</p> <p>Inspect the Active Grille Air Shutter harnesses for cuts or nicks near the connectors.</p> <ul style="list-style-type: none"> • If NO damage is evident, refer to further diagnostics, in SI. • If damage is evident, replace the forward lamp wiring harness connector with the connector kit listed in the Parts table below. Refer to <i>Connector Repairs</i>, in SI.

Parts Information

Causal Part	Description	Part Number	Qty
N/A	CONNECTOR KIT,WRG HARN	19352416	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430860	Connector Kit Replacement	Use Published Labor Operation Time

Version	1
Modified	Released September 17, 2019

