

WJ90 Workshop campaign - Checking hinge for convertible-top compartment lid

Version 4

English (US)

- › Overview
- › Porsche Mobility
- › Required materials
- › Required software
- › Warranty processing
 - › Scope 1: Checking hinge for convertible-top compartment lid
 - › Scope 2: Checking hinge for convertible-top compartment lid and re-coding control unit for convertible top
 - › Scope 3: Checking and adjusting hinge for convertible-top compartment lid
 - ›
Scope 4: Checking and adjusting hinge for convertible-top compartment lid and re-coding control unit for convertible top
- › Further information

WJ90 Workshop campaign - Checking hinge for convertible-top compartment lid

Overview

There is a possibility that the end position in the actuating mechanism for the convertible-top compartment lid on the affected vehicles may not be reached due to unfavorable tolerances. This could result in the convertible top being partially released.

Partial release of the convertible top will not be noticed by the customer because no warning message is displayed. As a result, the convertible-top compartment lid could lift up slightly at high speeds and could cause problems such as visible shaking and loud wind noise.

To prevent this from happening, the setting of the hinges on the convertible-top compartment lid must be checked and adjusted if necessary. The control unit for the convertible top may also have to be re-coded, depending on the date of manufacture of the vehicle.

Model type	911 Targa (991)
Model year	from 2014 to 2019
Manufacturing period	between 07/26/2013 and 10/04/2018
Number	4,104

Porsche Mobility

If requested, the mobility of the affected customer can be guaranteed by offering a suitable replacement vehicle.

Please invoice this additional service with the campaign scope via WWS.

Required materials

Usually already available in the Porsche Centre; only order if additional materials are required.

Part No.	Designation	Quantity/vehicle	Parts return
00004330509	Krytox GPL205, 60g tube	0.1 ea.	No

Required software

PIWIS Tester 3 test software version	37.300.000 (or higher)
--------------------------------------	------------------------

Warranty processing

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

Scope 1: Checking hinge for convertible-top compartment lid

Damage code	WJ90 66 000
Repair code	1
Working time	36 TU

Scope 2: Checking hinge for convertible-top compartment lid and re-coding control unit for convertible top

Damage code	WJ90 66 000
Repair code	1
Working time	50 TU

Scope 3: Checking and adjusting hinge for convertible-top compartment lid

Damage code	WJ90 66 000
Repair code	1
Working time	467 TU

Scope 4: Checking and adjusting hinge for convertible-top compartment lid and re-coding control unit for convertible top

Damage code	WJ90 66 000
Repair code	1
Working time	481 TU

Further information

Work instruction

TI No. 172/18, Group 6, Service, WJ90

For further information, please contact:

Ryan Cooney
Senior Regulatory Affairs Consultant
ryan.cooney@porsche.us

[991 6 172-18 WJ90 Checking hinge for convertible-top compartment lid.pdf](#)

527.3 KB
(349 views)

[WJ90 VIN List.xlsx](#)

189.8 KB
(35 views)

Created by [Ryan Cooney](#) on Jun 5, 2019 1:24 AM. Last modified by [Mitchell Grasser](#) on Aug 13, 2019 3:06 PM.

Categories: Workshop Campaigns, 911 Carrera

Tags : [workshop](#), [991 carrera](#), [year k](#), [wj90](#)

1726 Views

Content and Topics

Your Groups >

Your Content >

Your Places >

Personal

Edit Profile >

Change Password >

Manage

Admin Console >

PPN Administration >

Create

Discussion >

Files >

Document >

Collaboration >

Document

Blog Post >

Poll >

Message >

Event >

Photo Album >

Idea >

Space >

© 2019 Dr. Ing. h.c. F. Porsche AG. Legal notice. Copyright. Terms of use. Privacy Policy. Cookie Policy. [011](#)