

## 2014 UH200A Speedometer and Tachometer Needle Adjustment

**Affected Models:** 2014 UH200A (Burgman 200)

**Affected Departments:** Management, Service, Warranty, Sales

If a customer brings a UH200AL4 (Burgman 200) to your shop complaining that the speedometer and/or tachometer needle does not fully return to zero (home), it is possibly caused by one of two things:

- The unit has experienced an impact, which has jolted the needle within the speedometer assembly.
- The ignition has been turned ON, and while the system is still initializing it is abruptly interrupted by the ignition being turned OFF.

To correct this, adjust the needle as follows:

- 1) Turn the ignition switch to **OFF**, then turn it **ON** again.
- 2) If the needle does not return to the zero (home) position, repeat this procedure until it functions normally and returns to zero.
- 3) If the procedure above does not correct the problem after several attempts, replace the speedometer assembly.

