



Preliminary Information

PIP5682 MIL/ Check Engine Light with DTC P2C7A and/or P14D9

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2020	All	All	3.0 LM2	All
GMC	Sierra 1500	2020	All	All	3.0 LM2	All

Involved Region or Country:	North America
Condition:	MIL illuminated with DTCs P2C7A and/or P14D9 set
Cause:	Software anomaly in the engine calibration

Correction:

If you experience the condition described above evaluate the vehicle for any other concerns.

If no other concerns are found and you have the concern noted above, it will be necessary to perform the following:

Clear the DTCs.

Perform a NOx sensor #1 reset

Perform a NOx catalyst reductant loading reset

After all resets have been completed, perform a Diesel Particulate Filter (DPF) Service Regeneration Procedure and return the vehicle to customer

Engineering is aware of the concern and an updated calibration is being developed.

This PI will be updated, or a bulletin will be released at that time.

Warranty Information

Labor Operation:	Description:	Labor Time:
4025912	Diesel Particulate Filter (DPF) Service Regeneration	Use Published Time

Version History

Version	1
Modified	10-01-2019 - Created on

