



Bulletin No.: PIT5714
Published date: 10/8/2019

Preliminary Information

PIT5714 One or More Courtesy Lamps Illuminated at all Times

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT6	2020	All	All	All	All


Involved Region or Country	North America
Condition	A vehicle may exhibit a concern where the courtesy lamps are illuminated and will not turn off.
Cause	Circuit 157 may be shorted to circuit 650 or to ground above the grab handle located on the driver's side of the vehicle at the second row seat.

Correction:

Remove the grab handle located above the left side second row seat.



Inspect the harness above the headliner for damage.

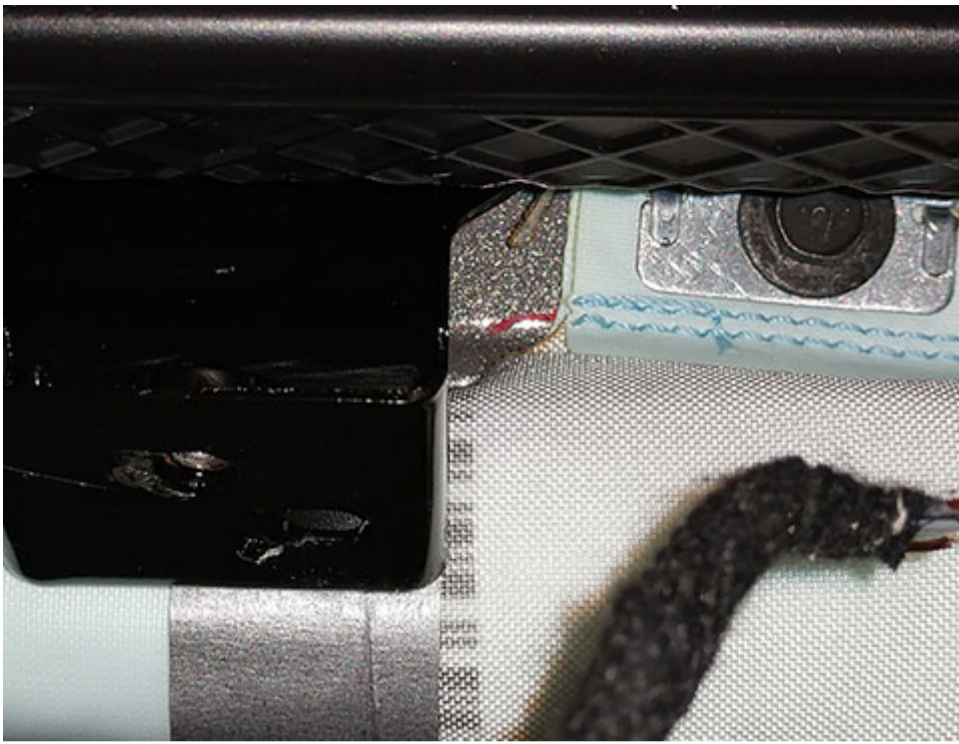

If damage is found on circuit 157 or 650 repair the circuit(s) following appropriate SI procedure found in "Wire and Connector Repair"



If no damaged circuits are found follow normal SI diagnostics.

Version History

Version	1
Modified	10/08/2019 - Created on

