



Preliminary Information

PIT5675C Diagnostic Tip: Loss of Power Steering Assist May Have Chassis Bus Communication Codes or C0800 in The PSCM

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	All	All	All	All
GMC	Terrain	2018 - 2020	All	All	All	All

Involved Region or Country:	North America
Condition:	Loss Of Power Steering Assist May Have Chassis Bus Communication Codes Or C0800 In The PSCM.
Cause:	Inspect G112 for a regular nut versus a shouldered nut. If a regular nut is installed it will not provide proper clamp load on the ground lug.

Engineering is reviewing this concern with the assembly plant. This may become a bulletin as more information becomes available.

Parts Information

Casual Part	Description	Part Number	Quantity
X	Shouldered Nut	11570533	1

Version History

Version	3
Created	04/18/2019 - Created on. 04/30/2019 - Updated to add picture. 08/22/2019 - Added 2020 model Year 10/15/2019 - Added part number



GENERAL MOTORS