



Preliminary Information

PIP5496B Fuel Tank Hard To Fill Possible MIL With DTC P0446

Proactive


Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|---------|--------------|------|-----|-----------------------|----------------|
| | | | from | to | | |
| Chevrolet | Equinox | 2018 - 2020 | All | All | 1.5L LYX and 2.0L LTG | All |
| GMC | Terrain | 2018 - 2020 | All | All | 1.5L LYX and 2.0L LTG | All |

| | |
|-----------------------------------|--|
| Involved Region or Country | North America |
| Condition | Fuel tank hard to fill with fuel, evaporative emission canister saturated with fuel and possible DTC P0446. |
| Cause | Vent hose disconnected from fuel pump module assembly inside fuel tank. |

Correction:

Reconnect fuel vent hose to fuel pump module inside fuel tank. Reference picture below showing properly connected fuel vent hose.

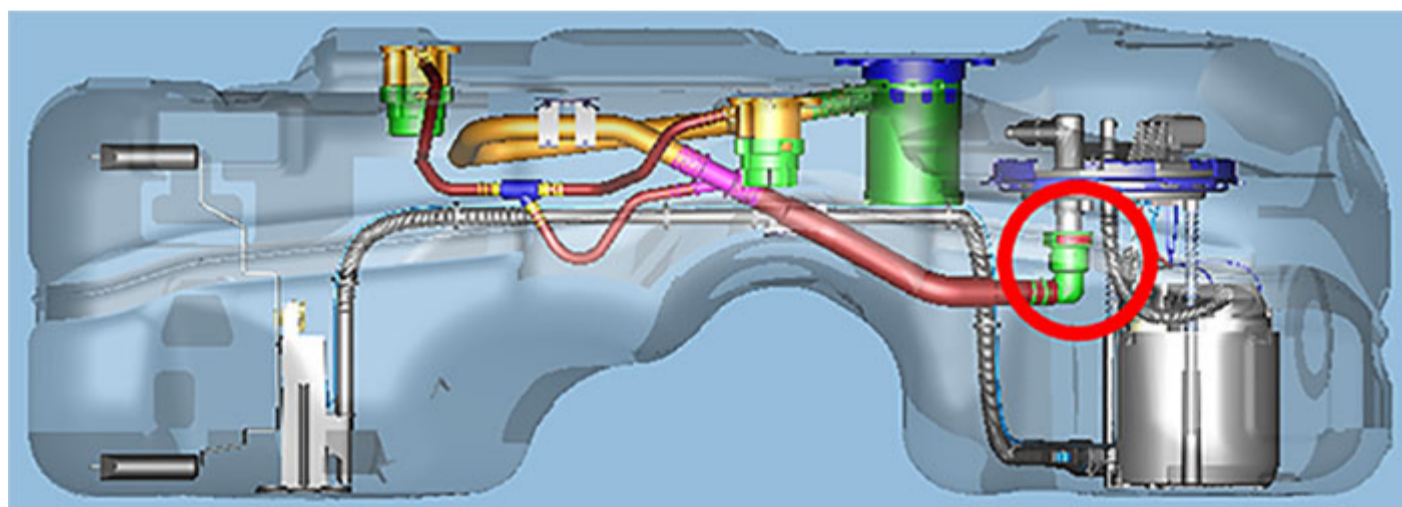

Also inspect evaporative emission canister for fuel saturation and replace canister as needed.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time |
|-----------------|------------------------------|--------------------------|
| 4028730 | Fuel Pump Module replacement | Use Published Labor Time |

| Labor Operation | Description | Labor Time |
|-----------------|---|--------------------------|
| 4027950 | Evaporative Emission Canister Replacement | Use Published Labor Time |

Version History

| | |
|-----------------|--|
| Version | 3 |
| Modified | 05/03/2017 - Created on. 10/17/2017 Update to include 2018 GMC Terrain and 2.0 LTG 10/17/2019 Updated to include 2019 and 2020 model years |



© 2019 General Motors. All Rights Reserved.