



Preliminary Information

PIT5718 Diagnostic Tip- No Fob Detected Message/Service Tire Monitor System

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	All	All	All	All
GMC	Terrain	2018 - 2020	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment of keyless entry inoperative, no fobs detected message when attempting to start or service tire monitor message while driving.
Cause	Inspect for poor connections at the K77 Remote Control Door Lock receiver

Correction:

To correct this concern reinstall any backed out terminals or replace any terminals with poor terminal tension at the K77 Remote Control Door Lock Receiver.

Version History

Version	1
Modified	10/29/2019 - Created on



GENERAL MOTORS