


MIL ON With DTC P01201C

Service Category Engine/Hybrid System

Section Engine Control

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2018 - 2019	RX350	VDS(s): BZMCA, DZKCA, GZKCA, ZZMCA Engine(s): 2GR

Introduction

Some 2018 – 2019 model year RX350 and RX350L vehicles may exhibit a MIL ON condition with DTC P01201C (Throttle / Pedal Position Sensor / Switch “A” Circuit Voltage Out of Range) occurring within 5 seconds of engine start time.

The Engine Control Module/ECM (SAE Term: Powertrain Control Module/PCM) logic has been modified to reduce the possibility of these conditions. Follow the Repair Procedure in this bulletin to address these conditions.

MIL ON With DTC P01201C

Warranty Information

OP CODE	DESCRIPTION	TIME	MODEL NAME	MODEL YEAR	WMI	DRIVETRAIN	OFF	T1	T2
800269	Engine ECU Reprogramming (per FRM)	0.7	RX350	2018 – 2019	2T2	2WD Non F-Sport	89661-0EE8#	8A	74
						2WD F-Sport	89661-0EF0#		
						4WD Non F-Sport	89661-0EE9#		
						4WD F-Sport	89661-0EF1#		
			RX350L		JTJ	4WD Non F-Sport	89661-48X0#		
						2WD	89661-48X1#		
						4WD	89661-48X2#		

APPLICABLE WARRANTY

- This repair is covered under the Lexus Federal Emission Warranty. This warranty is in effect for 96 months or 80,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

MODEL NAME	MODEL YEAR	WMI	DRIVETRAIN	PART NUMBER		PART NAME	QTY
				PREVIOUS	NEW		
RX350	2018 – 2019	2T2	2WD Non F-Sport	89661-0EE8#	89661-0EE82	Computer, Engine Control (ECM)	-
			2WD F-Sport	89661-0EF0#	89661-0EF02		
			4WD Non F-Sport	89661-0EE9#	89661-0EE92		
			4WD F-Sport	89661-0EF1#	89661-0EF12		
RX350L		JTJ	4WD Non F-Sport	89661-48X0#	89661-48X02	Computer, Engine Control (ECM)	-
			2WD	89661-48X1#	89661-48X12		
			4WD	89661-48X2#	89661-48X22		
-				00451-00001-LBL		Authorized Modifications Labels	1

MIL ON With DTC P01201C

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream ADVi*	ADE	TSADVUNIT	1
Techstream 2.0		TS2UNIT	
Techstream Lite		TSLITEPDLR01	
Techstream Lite (Green Cable)		TSLP2DLR01	

*Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 14.20.019 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.
- Use Techstream or an approved J2534 interface to perform flash reprogramming updates. Visit techinfo.toyota.com for more information regarding J2534 reprogramming.

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Battery Diagnostic Tool	DCA-8000P T	1

*Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

MIL ON With DTC P01201C

Calibration Information

MODEL	MODEL YEAR	WMI	DRIVETRAIN	CALIBRATION ID		
				PREVIOUS	NEW	
RX350	2018 – 2019	2T2	2WD Non F-Sport	896630E58000	896630EA3300 / 896650E48300	
				896630EA3000		
				896630EA3100		
				896630EA3200		
				896650E24000		
				896650E48000		
			896650E48100			
			896650E48200			
			2WD F-Sport	896630E59000		896630EA5300 / 896650E48300
				896630EA5000		
				896630EA5100		
				896630EA5200		
896650E24000						
896650E48000						
896650E48100						
896650E48200						
4WD Non F-Sport	896630E60000	896630EA4300 / 896650E48300				
	896630EA4000					
	896630EA4100					
	896630EA4200					
	896650E24000					
	896650E48000					
896650E48100						
896650E48200						
4WD F-Sport	896630E61000		896630EA6300 / 896650E48300			
	896630EA6000					
	896630EA6100					
	896630EA6200					
	896650E24000					
	896650E48000					
896650E48100						
896650E48200						

MIL ON With DTC P01201C

Calibration Information (continued)

MODEL	MODEL YEAR	WMI	DRIVETRAIN	CALIBRATION ID	
				PREVIOUS	NEW
RX350	2018 – 2019	JTJ	4WD Non F-Sport	896630E60000	896630EA4300 / 896650E48300
				896630EA4000	
896630EA4100					
896630EA4200					
896650E24000					
896650E48000					
RX350L	2018 – 2019	JTJ	2WD	8966348S6000	8966348W1300 / 896654852300
				8966348W1000	
				8966348W1100	
				8966348W1200	
			896654843000		
			896654852000		
4WD	8966348S7000	8966348W2300 / 896654852300			
	8966348W2000				
	8966348W2100				
	8966348W2200				
896654843000					
896654852000					
896654852100					
896654852200					

MIL ON With DTC P01201C

Repair Procedure

1. Confirm the condition exists.
 Is there a MIL ON with DTC P01201C within 5 seconds of engine start time?
 - **YES** — Continue to step 2.
 - **NO** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

2. Use Techstream to confirm if the ECM (PCM) calibration has been updated and check for the Authorized Modifications Label affixed to the vehicle in the location shown below.
 Is the calibration ID listed in Techstream and on the label the latest ECM (PCM) calibration?
 - **YES** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
 - **NO** — Continue to step 3.

Figure 1. Location of Authorized Modifications Label on 2016 – 2019 RX350 and RX350L



1	Replacement ECM (PCM) Part Number (e.g., 89661-0EE82)
2	New Calibration ID (e.g., 896630EA3300)
3	Dealer Code

4	Date Completed
5	This SB Number

MIL ON With DTC P01201C

Repair Procedure (continued)

3. Flash reprogram the ECM (PCM).

NOTE

- The battery diagnostic tool **MUST** be used in Power Supply Mode to maintain battery voltage at 13.5V while flash reprogramming the vehicle.
- For details on how to use the battery diagnostic tool, refer to the [DCA-8000 Instruction Manual](#) located at *TIS – Diagnostics – Tools & Equipment – Battery Diagnostics*.

Follow the procedures outlined in Service Bulletin [L-SB-0001-18](#), *Techstream ECU Flash Reprogramming Procedure*, and flash the ECM (PCM) with the NEW calibration file update.

4. Prepare and install the Authorized Modifications Label.
 - A. Using a permanent marker, enter the following information on the label:
 - ECM (PCM) part number [*Refer to the **Parts Information** section for the **NEW PART NUMBER***]
 - Calibration ID(s) [*Refer to the **Calibration Information** section for the **NEW CALIBRATION ID***]
 - Dealer Code
 - Repair Date
 - Change Authority [***This bulletin number***]
 - B. Install the Authorized Modifications Label onto the vehicle at the location shown in Figure 1. The Authorized Modifications Label is available through the MDC, P/N 00451-00001-LBL.
5. Test-drive the vehicle to confirm proper operation.