

SS 1034538 WST 5700 Intermittent Headlight Issues

WST 5700 Intermittent Headlight Issues

Applicable Vehicles

All WST 5700 Built before 11/1/19

Concern

Hood harness runs from the hood to the chassis and has potential to get folded between the bumper and screen when the hood is closed. Chafing occurs causing intermittent headlight issues (lights on and off, high beam comes on when in low beam setting).

Note: Each headlight has a dedicated circuit and therefore both headlights going out at the same time is not expected.

Rub point can be seen in picture below



Solution

Addition of 48-26131 twist-tube per spec 49-00316-000. Add length to breakout and add clipping point to front cross-member to keep harness off fill-gap screen when hood is closed.

Illustration of fix can be seen in picture below

