



# Service Bulletin

Bulletin No.: 19-NA-234

Date: October, 2019

## TECHNICAL

**Subject: Squeak and/or Creak Type Noise Heard When Applying Brakes and/or Cycling the Pedal While in Park**

Brand:	Model:	Model Year:		Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2018	2019	-	-	-	-
	Blazer	2019					
GMC	Terrain	2018					

<b>Involved Region or Country</b>	North America, Middle East, Israel, Argentina, Brazil, Chile, Columbia, Ecuador, Paraguay, Peru, Uruguay, South Korea, China, Thailand, Australia, New Zealand, Egypt and Africa.
<b>Condition</b>	Some customers may comment that a squeak and/or creak type noise heard when applying the brake and/or cycling the pedal while in park. Technicians may find the noise to be coming from the master cylinder area.
<b>Cause</b>	<p><b>Note:</b> This condition may have different causes. The technician will need to diagnose the correct cause before beginning the correction.</p> <p><b>Cause 1 (2018 Equinox, Terrain ONLY)</b> This condition may be caused by the brake pedal pivot rod rotating in the pivot tower, causing the spring clip and the pivot rod head to rub against the plastic bracket.</p> <p><b>Cause 2 (2018-2019 Equinox, Blazer, Terrain)</b> The noise may be caused by the current DOT 3 brake fluid in the braking system.</p> <p><b>Note:</b> There are <b>NO</b> quality issues with the current dot 3 fluid.</p>
<b>Correction</b>	<p><b>Correction 1 (2018 Equinox, Terrain ONLY)</b> Spray a lubricant on the brake pedal pivot rod, and cycle the brake pedal.</p> <ul style="list-style-type: none"> <li>If the noise goes away, replace the brake pedal assembly. <i>Refer to Brake Pedal Assembly Replacement in SI.</i></li> </ul> <p><b>Important: This portion ONLY applies to vehicles built with Vin L and S in the 11th digit.</b></p> <p><b>Correction 2 (2018-2019 Equinox, Terrain)</b> If the noise was not eliminated by applying the lubricant to the pedal pivot rod.</p> <ul style="list-style-type: none"> <li>Bleed the braking system and fill with DOT 3 brake fluid. <i>Refer to Hydraulic Brake System Bleeding in SI.</i></li> </ul> <p><b>Correction 2 (2019 Blazer)</b></p> <ul style="list-style-type: none"> <li>Bleed the braking system and fill with DOT 3 brake fluid. <i>Refer to Hydraulic Brake System Bleeding in SI.</i></li> </ul>

## Parts Information

Causal Part	Description	Part Number	Qty
X	PEDAL, BRK	84479803	1
N/A*	FLUID, BRAKE (DOT 3)	Refer to EPC	-

\*For warranty transactions, **DO NOT** mark this/these parts as the Causal Part. Enter the word "Bulletin" in the Causal Part Description free-flow text field

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2440122	Hydraulic Brake System Bleeding	Use the Published Labor Operations Time
2441980	Brake Pedal Assembly Replacement	

Version	1
Modified	Released October 15, 2019

