



15-19-04TT - Check Engine Light is ON After Camshaft Adjuster Repair or Long Block Replacement, DTC P0017 Stored

Release date: 11/22/2019

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2017- 2019	1.4L (DGXA, DJXA)	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2057852/1	11/22/19	15-19-04TT	Original publication.

Technical Background

Failure to reinstall oil sleeves when servicing cam shafts and adjusters.

Service

When removing the camshaft adjusters, note that both adjusters have an inner oil sleeve (figure 1). The sleeves must be reinstalled on both adjusters, whenever installing the adjusters on the camshafts (figure 2). Failure to install both sleeves will result in DTC P0017 to setting.

DTC	Description
P0017	Crankshaft Position-Camshaft Position Correlation Bank 1 Sensor B

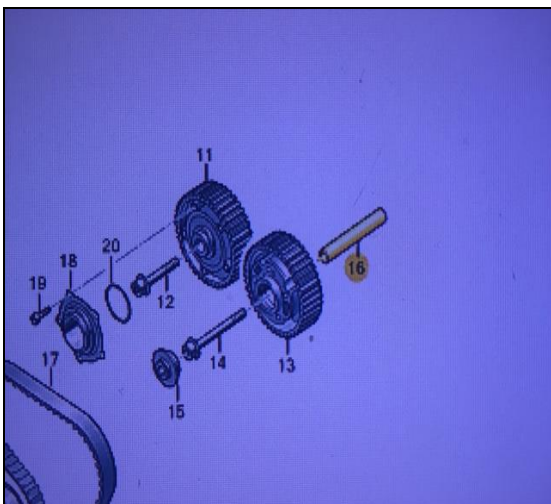


Figure 1



Figure 2



15-19-04TT - Check Engine Light is ON After Camshaft Adjuster Repair or Long Block Replacement, DTC P0017 Stored

Release date: 11/22/2019

Additional Information

© 2019 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.