



Service Bulletin

E246

Section

45 - Engine

Description

EPA2013 and EPA2017 PACCAR MX-13 and MX-11 Engine Mounted Fuel Filter Installation

Release Date

11/1/2019

Introduction

Due to a design change in the fuel filter module, updated fuel filter installation procedures are now available in Repair & Maintenance RMI. The new design entered production in October 2018 and has superseded previous filter module part numbers.

Resolution


Information Only

Refer to the updated fuel filter installation procedures in Repair & Maintenance RMI.

Failure to follow the updated procedure can lead to the following symptoms:

- Low fuel pressure fault codes
 - P1087: Fuel Pressure – Data valid but too low, moderately severe
 - P0087: Fuel Pressure – Data valid but too low, most severe
- Low Power
- Crank no start

The following images show fuel filter damage typically caused by not lubricating the fuel filter seal and rotating it during installation. Notice the depressions and tears in the [seal](#).

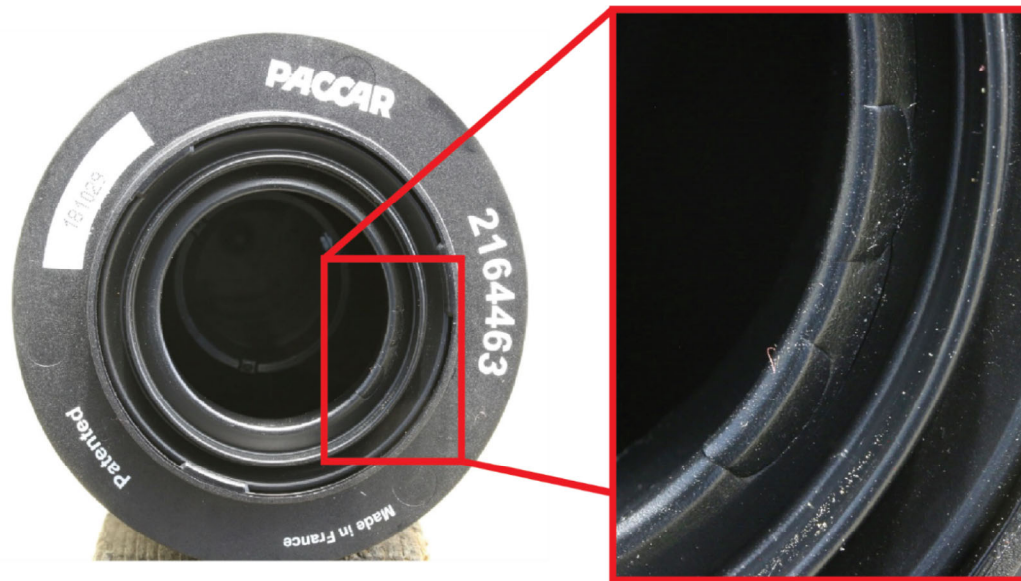

Authored by: RP

Access to PACCAR's Enterprise Portal is provided as a benefit of doing business with PACCAR. All applications and content accessed through this system are confidential and proprietary and the property of PACCAR Inc and its suppliers, and must be kept strictly confidential pursuant to the contract licensing such access. Disclosure, publication, release or distribution of any material found on PACCAR systems to any person other than employees with a need to know such information is strictly prohibited. All activity on this system is monitored. If PACCAR suspects or discovers any unauthorized activity, access may be immediately terminated without prior notification. Violators may be subject to legal action.

© Copyright 2019 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).