




MPD UPDATE


Powertrain



Discovery Engine Speed Fluctuation	17-19MY 3.0L TDV6 Discovery
<p><u>Problem Description:</u></p> <ul style="list-style-type: none"> - TDV6 17MY L462 vehicles experience a hesitation/shudder while driving approximately 30-55 mph and 1400-2000 RPMs, approximately ¾ into warm-up phase and the engine speed begins to flutter visibly on the tachometer. <p><u>Current Status:</u></p> <ul style="list-style-type: none"> - Cases are predominantly out of Canada with P0107-16 & P0069-17 stored in the PCM. P242B may be stored in addition. <p><u>Recommended Actions:</u></p> <ul style="list-style-type: none"> - Inquire with the customer if this was after a recent fill up & what station is used to fill the vehicle - Ensure the PCM is at the current level - If symptom continues after update, confirm that the fuel is diesel, check for exhaust leaks, & diagnose any other codes. If no root cause is found, raise a TA with all the primary & secondary diagnosis included 	
KPI's	
Total VIN Count	Status
	
Issue Owner	
Elyse McArthur	

 Solution Unavailable or project not yet accepted

 Solution known, not yet delivered

 Service Fix Available, Communication Published

