

H223NAS2

TECHNICAL BULLETIN

22 NOV 2019



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION:

303-14

SUBJECT/CONCERN:

Emissions Recall - Service Diagnostic Tool Unable To Read Vehicle Identification Number (VIN)

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
F-TYPE (X152)	2018	K47341-K55799	Castle Bromwich

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

A potential issue has been identified on certain Jaguar vehicles within the listed Affected Vehicle Range where, if the vehicle is subjected to state inspection, the Vehicle Identification Number (VIN) is not read using a handheld diagnostic tool during vehicle functionality testing. This concern does not affect the vehicle's emissions output.

ACTION:

Retailers are required to HOLD affected new vehicles that are within your control and refrain from releasing the vehicles for new vehicle sale pending completion of the procedure(s) detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but must have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:**NOTES:**

- An allowance of \$0.50 (USD) is provided for the Authorized Modification Label and CA Vehicle Emission Recall - Proof of Correction Certificate.
- * Order only the expected percentage demand of parts identified
- ** Order quantity of '1' (one) includes a pack of 100 labels
- *** Order quantity of '1' (one) is a pack of 25 certificates

DESCRIPTION	PART NUMBER	QUANTITY	EXPECTED PERCENTAGE DEMAND*
Authorized Modification Label	JLM21848	1**	100
CA Vehicle Emission Recall - Proof of Correction Certificate (California-registered vehicles only)	JLM21849	1***	100 (California-registered vehicles only)

WARRANTY:

NOTE:

Use the Jaguar Land Rover (JLR) claims submission system to make sure that a vehicle is eligible for this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that all open Recall and Service Actions are identified to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting the Program Code and the relevant Option Code; this will result in payment of the stated time. The SRO and parts information is included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times/prices are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.

Warranty claims must be submitted or payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PART NUMBER	VALUE
H223	A	Powertrain Control Module (PCM) - Update - Replace ECU	85.18.03	0.2	ZZZ001	\$0.50
H223	B	PCM - Update - Replace ECU Drive in/drive out	85.18.03 10.10.10	0.2 0.2	ZZZ001 -	\$0.50 -

An allowance of \$0.50 (USD) is provided for the Authorized Modification Label and CA Vehicle Emission Recall - Proof of Correction Certificate.

Normal Warranty policies and procedures apply.

DIAGNOSTIC INSTRUCTION:

1.

CAUTION:

A JLR-approved battery support unit must be connected to the vehicle startup battery during diagnosis / module programming.

Connect the JLR-approved battery support unit to the vehicle startup battery.

2.

NOTE:

The JLR-approved diagnostic equipment must be loaded with PATHFINDER version 259 (or later).

Connect the JLR-approved diagnostic equipment to the vehicle and begin a new session.

3.

NOTE:

The JLR-approved diagnostic equipment will read the correct VIN for the current vehicle and automatically take the vehicle out of Transit mode (if required).

Follow all on-screen instructions.

4. Select 'ECU Diagnostics'.

5. Select 'PCM'.

6. Select 'Update ECU'.

- 1. Follow the on-screen instructions until the application finishes successfully.

7. **Only if required:** set the vehicle to Transit mode.

8. Exit the current session.

9. Disconnect the diagnostic equipment and battery support unit from the vehicle.

10. Install a completed 'Authorized Modification Label' to the radiator support panel.

11. **California-registered vehicle only:** hand customer completed 'CA Vehicle Emission Recall - Proof of Correction Certificate' at vehicle handover.