





MPD UPDATE


Powertrain



18MY onward RR/RRS equipped with AJ133 Check Engine MIL		18MY onward Range Rover, Range Rover Sport equipped with AJ133 engine	
<p><u>Problem Description:</u></p> <ul style="list-style-type: none"> - The Check Engine MIL is on. <p><u>Current Status:</u></p> <ul style="list-style-type: none"> - DTC P026B-00 is stored in the PCM along with cylinder-specific injector offset DTC(s). - The diagnostic is running during warm up phase and incorrectly setting the DTC(s). - A revised PCM calibration will be released to address this condition. <p><u>Recommended Actions:</u></p> <ul style="list-style-type: none"> - As an interim measure, rotate the affected fuel injectors to a different cylinder location. - Clear DTCs stored and reset PCM adaptations. 			
KPI's			
Total VIN Count	Status	Issue Owner	
		Matt Priestner	

 Solution Unavailable or project not yet accepted

 Solution known, not yet delivered

 Service Fix Available, Communication Published

