

P0234-77 Turbocharger Under boost with a Restricted Performance Message	17-19MY Range Rover, RR Sport, Discovery
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none"> • Check Engine Lamp illuminated on the Instrument Cluster <p><u>Technical Description:</u></p> <ul style="list-style-type: none"> • TDV6 16-18MYMY3.0L TDV6 equipped vehicles have a MIL and “Restricted Performance” on the instrument cluster and P0234-77 stored in the PCM <p><u>Status:</u></p> <ul style="list-style-type: none"> • Under Investigation • Follow LTB01204, if applicable. If P0234-77 is still stored or the DPF will not regenerate, check if the soot levels decrease. P0234-77 inhibits regeneration. If the DPF cannot be regenerated during a drive or PATHFINDER procedure, raise a Technical Assistance case for further instruction. Should LTS instruct you to replace the DPF, please raise an EPQR. 	