



Preliminary Information

PIT5721 Lane Keep Assist Icon Missing From IPC And Gap Switch Inoperative

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	All	All
GMC	Sierra 1500 (New Model)	2019	All	All	All	All
Chevrolet	Silverado 1500	2020	All	All	All	All
GMC	Sierra 1500	2020	All	All	All	All

Involved Region or Country	North America
Condition	<p>Some dealers may experience one or more of the following conditions:</p> <ol style="list-style-type: none"> 1. Lane Keep Assist switch LED always stays on. 2. The Forward Collision Alert gap switch is inoperative 3. The Lane Keep Assist icon doesn't show up on the IPC. <p>Note: The Lane Keep Assist icon will not show up on the IPC but the green car icon, for Forward Collision Alert and Forward Automatic Braking, will still illuminate when a vehicle is detected ahead</p>
Cause	<p>This condition may be caused by the B174W Frontview Camera not being SPS configured after a programming event.</p>

Correction:

Perform all the proper SPS programming and SPS configuration as per the program and set up procedure in SI and then perform the front view camera module learn.

Version History

Version	1
Modified	11/12/19 - Created



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.