

Technical Journal

TITLE:

Check engine light On, DTC ECM-P0EBF24

REF NO:	NO: ISSUING DEPARTMENT:		CAR MARKET:		
TJ 34446.3.0	Technical Service	United States and Canada			
	PARTNER:	ISSUE DATE:	STATUS DATE:		
3 US 7	′510 Volvo Car USA	2019-09-13	2019-10-15		
FUNC GROUP:	FUNC DESC:				
2700	2700 Engine controls		1 of 2		

"Right first time in Time"

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
234	BR	B1FPHEV					2019-2020		-	201817-201927
235	BR	B1FPHEV					2019-2020		-	201817-201927
236	BR	B1FPHEV					2019-2020		-	201817-201927
246	BR	B1FPHEV					2019-2020		-	201817-201927
256	BR	B1FPHEV					2019-2020		-	201817-201927

CSC Customer Symptom Codes

Code	Description
DL	Warning lights and chimes/Malfunction Indicator Light ("Check engine" light) indication/no indication

VST Operation Number

VST Operation Number	Description		
36004-2	Software control module downloading		

DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
ECM	P0EBF24	Intermittent

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Technical Journal 34446.3.0



Text

DESCRIPTION:

*Structure week range and information in "Service" updated.

If a Check Engine Light in combination with DTC ECM-P0EBF24 "Temperature sensor A" is set in vehicle, please follow "Service".

Technical explanation:

If the customer uses the Pre-Condition function (also called Parking Climate) or Remote Start with a charged High Voltage battery, then this DTC could be set when the car is started afterward.

This has been identified as misdetection in the Software.

ECM = Engine Control Module

SERVICE:

New software has been released.

Perform an upgrade of the software according to TJ 31543.

Warranty claim info:

To get warranty claim accepted for a job described in this TJ, please use following data:

VST OP number: 36004-2

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 2700.

Page 2 of 2 2019-10-15