

## GPOP - Issue Review System

**Part Number:** 68359946A\$, RL359946A\$, 68241331A\$, 68368596A\$, 68490840A\$, 68490848A\$, 68490845A\$, 68490851A\$

**Part Description:** SI-eVT Transmission - China Variant & 9 inertia ring bolts

---

**Issue Description:** For SI-eVT Transmission ONLY: Replace the nine (9) flywheel to damper bolts (68382486AA) when replacing the SI-eVT per TechConnect procedure.

SI-eVTs built prior to January 11, 2019 had a 05192374AB level cooler. Using service SI-eVT built after Jan 11 2019 with the 05192374AC level cooler requires new 68238385AB inlet hose and 68238386AC outlet hose.

The service SI-eVT is shipped with a non-China wiring harness (68241331AC). China market replacement must replace wiring harness with 68368596AA. The China variant 68368596AA wiring harness has an interlock to the electrical charge door.

~  
Contact us at [CAGRIS@Chrysler.com](mailto:CAGRIS@Chrysler.com) for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.

---