



Service Bulletin

Bulletin No.: 19-NA-068

Date: November, 2019

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated, Intermittent Service Messages, Gauges May Be Erratic - DTCs U0073, U0121, U0100 and/or U0101 Set, G103 Inspection


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	TRAX	2015	2019			All	All

Involved Region or Country	United States, Canada, Mexico, Argentina, Brazil, Colombia, Ecuador, Paraguay, Uruguay
Condition	Some customers may comment on a MIL illuminated, service messages may be displayed intermittently, and/or gauges may be erratic. Technicians may find DTCs U0073, U0121, U0100 and/or U0101 Set.

Cause




5300153

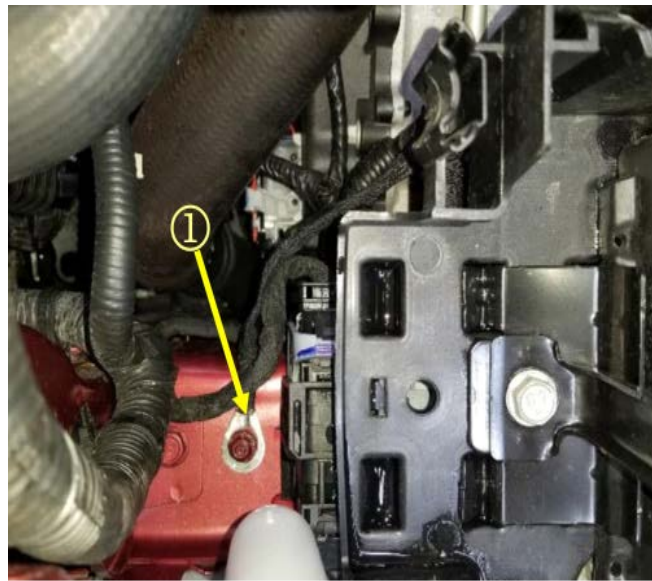

5300152

The cause of the condition may be a poor ground connection at G103 (1), located at the left front frame rail in front of the battery.

<p>Correction</p>	<div style="text-align: right;">  </div> <p style="text-align: right; font-size: small;">5312724</p> <p>Important: Check resistance of the stud, as well as the nut and ground eyelet. If equipped with hex shaped/anti-rotational feature, after cleaning, ensure that the eyelet fully seats down onto the stud hex feature before torquing the fastener.</p> <p>Perform inspection on ground G103; clean and/or remove paint from the grounds contact points and torque fastener to specification.</p> <p>⇒ Refer to Fastener Specifications in SI.</p>
--------------------------	---

Parts Information

No parts are normally required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430962	Ground Connection Repair	Use Published Labor Operation Time

Version	2
Modified	Released April 04, 2019 November 12, 2019 – Removed the Holden Trax model, updated the Involved Region or Country section, updated the Subject and Condition for possible erratic gauges and added Additional Keywords.

Additional Keywords: G103, SES, CEL

