

Subject

DTC B15A8 - DCM System Internal Failure**

Market

USA

Service Category

Audio/Visual/Telematics

Section

Cellular Communication

Applicability

All Applicable Models

APPLICABLE VEHICLES

2020	RAV4	2020	Camry
2020	Corolla Hatchback	2020	RAV4 HV
2020	Camry HV		

CONDITION

Some 2020 model year Camry, Camry HV, RAV4, RAV4 HV, and Corolla Hatchback vehicles equipped with a DCM may exhibit a B15A8** DTC (most likely B15A804) in history during PDS. This DTC can be triggered during the manufacturing and/or shipping process and does not indicate a problem with the vehicle. To simplify the diagnosis of this DTC, refer to the procedure below to prevent unnecessary parts replacement.

RECOMMENDATIONS

Is the DTC current or a history DTC?

- History – Clear the DTC
- Current and red SOS light is on - Disconnect the 12V battery for 30 minutes to reset/initialize the DCM
 - If the green SOS light is on, normal operation has been restored
 - If the condition has not changed, please diagnose per the repair manual.

LINK REFERENCES

This Tech Tip does not contain any link references