

Squeaking Noise from Exhaust Gas Flap

Topic number	LI49.10-P-064655
Version	3
Function group	49.10 Exhaust pipes, mufflers
Date	11-21-2019
Validity	AMG vehicles with exhaust gas flaps
Reason for change	Remedy revised and document reactivated
Reason for block	

Complaint:

Squeaking noise from the exhaust gas flap. Typically heard at standstill with light abrupt acceleration and during normal driving.

Cause:

Insufficient lubrication of exhaust flap shaft

Note:

Replacing components will not remedy the complaint

Remedy:

1. Remove the components of the exhaust system if necessary
2. Remove affected actuator
3. Spray the shaft of exhaust gas flap with high-temperature grease (see picture 1 and picture 2)
4. Check, during a test drive, if the noise has been rectified
5. If necessary, repeat the procedure

Note :

The arrows show the locations where the lubricant is to be applied.

Attachments	
File	Description
Bild 1.JPG	Picture 1
Bild 2.JPG	Picture 2

Symptoms
Power generation / Exhaust system / Noises / Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 989 91 51			High-temperature grease	1	Can be used for several vehicles	X

XENTRY TIPS

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			14C02 **	
			14R02 **	
			14335 H2	Models: A; CLA; GLA

WIS-References			
Document number	Title	Note	Allocation
AR49.10-P-	Remove/install components of exhaust system		Remedy