




Technical Service Bulletin

SUBJECT:		No: TSB-19-52A-005	
SECOND ROW CENTER SEAT BELT BUCKLE INTERFERENCE WITH RIGHT SEAT BELT BUCKLE		DATE: December 2019	
		MODEL: 2014-19 Outlander, 2018-19 Outlander PHEV	
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

PURPOSE

A customer may report that the second row right side seat belt buckle cover has come off, and in some instances, prevent the second row right side seat belt tongue from latching into the buckle when the internal buckle components have fallen off.

This may be caused by repeatedly folding the second row right side seat back while the center seat belt buckle is positioned on top of the right side seat belt buckle.

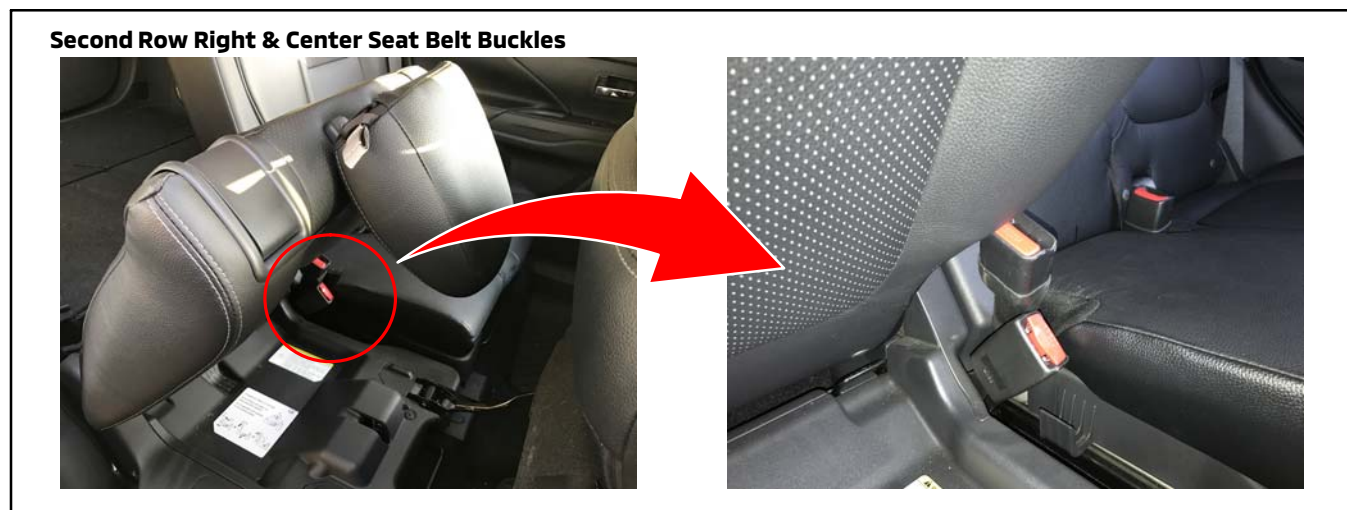

The second row center seat belt buckle length has been shortened by 14 mm to prevent the center seat belt buckle from covering the right side seat belt buckle.

This TSB instructs dealers to replace the second row right side seat belt buckle with a new part and install the countermeasure second row center seat belt buckle.

AFFECTED VEHICLES

2014 - 2019 Outlander built **before** the following VINs and dates:

- Okazaki production: **JA4AZ3A31KZ041007** (01/31/2019)
- PMC production: **JA4AZ3A34KJ001647** (04/01/2019)

NOTE: To identify production plant, see 7th digit from end of VIN: Z = Okazaki, J = PMC

2018 - 2019 OutlanderPHEV built **before** the following VIN and date:

- **JA4J24A55KZ041121** (02/01/2019)

REPAIR PROCEDURE

1. If a customer reports that the second row right seat belt buckle cover has come off, or has any difficulty latching either buckle, replace the parts. (Refer to the Parts Information section in this TSB for the correct part numbers.)

For detailed replacement instructions, refer to the applicable Service Manual:

- Group 52A-Interior -> Seat Belt -> Rear Seat Belt -> Removal and Installation

Rear Seat Belt Removal & Installation
(Example from 2019 Outlander Service Manual)

Second seat belt removal steps

1. Seat belt side lower anchor bolt
 - Rear scuff plate, rear scuff plate front, quarter trim lower, quarter trim upper (Refer to P.52A-11).
2. Seat belt side
 - Seat cushion assembly (LH)
 - Headlining (Refer to P.52A-18).
3. Seat belt center
4. Inner seat belt side (RH)
5. Inner seat belt center

Third seat belt removal steps <7 persons seat>

6. Inner seat belt side (LH)
7. Inner seat belt center (LH side)
8. Third seat belt sash guide cover
 - Quarter trim lower, quarter trim upper (Refer to P.52A-11).
9. Outer seat belt
10. Inner seat belt

ACC00813AB

2. Verify proper operation of both seat belt buckles and seat belts.

PARTS INFORMATION

Use only the Genuine Mitsubishi Parts listed below.

Description	Model	Part Number	Qty
Seat Belt Buckle, Rear Seat, Outer RH	Outlander (2014-2019)	7000D555XA*	1
Seat Belt Buckle, Rear Seat, Inner Ctr	Outlander PHEV (2018-2019)	7000G752XA	1

* This part number has not changed.

Identification Method of Seat Belt Buckle in Second Row Center Seat on Outlander & Outlander PHEV

By Child Part Number
 See number stamped on resin cover
 Before countermeasure: 1059691
 After countermeasure: 1084145

By Part Configuration
 Before countermeasure:
 7000D556XA (w/o harness)





WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Operation	Nature Code	Cause Code	Time Allowance
522053WF	Replace Second Row Right and Center Seat Belt Buckles	86D	5A0	0.3 hrs

Warranty Coverage: 5/60 Basic Coverage