



Technical Journal

TITLE:

Infotainment System (IHU) Resets/Reboots while driving (blank screen)REF NO:
TJ 31602.9.4ISSUING DEPARTMENT:
Technical ServiceCAR MARKET:
United States and CanadaPARTNER:
3 US 7510 Volvo Car USAISSUE DATE:
2019-11-26STATUS DATE:
2019-12-06FUNC GROUP:
3930FUNC DESC:
**Equipment for entertainment
(radio/TV/VC)**

Page 1 of 3

“Right first time in Time”**Attachment****Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224							2019-9999		-	201835-999952
225							2019-9999		-	201817-999952
227							2019-9999		-	201846-999952
234							2017-2017		-	201617-201716
235							2017-9999		-	201624-999952
236							2017-9999		-	201646-999952
238							2018-9999		-	201717-999952
246							2018-9999		-	201717-999952
256							2016-9999		-	201505-999952
536							2019-9999		-	201746-999952

CSC Customer Symptom Codes

Code	Description
32	Infotainment/System reboots
2E	Audio other/Keypad on center console does not work
DO	Audio other/Audio unit (complete) does not work
FC	Audio other/Other audio problems
6B	Buttons/control knobs on centre console (Media, communication and navigation)/No/reduced/incorrect function
7N	Navigation/Other navigation problems



VST Operation Number

VST Operation Number	Description
36004-2	Software control module downloading.

DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

* New software information added

IHU = Infotainment Head Unit

CCD = Center Console Display

DIM= Driver Information Module

The customer may report that the infotainment system in the vehicle re-starts or reboots intermittently while driving.

When this happens the CCD and the center area of the DIM will go blank for a few moments and then start back up as if the vehicle has just been started up.

The customer may also notice that the infotainment system is not responding as normal (ex.- long response time) just before this occurs.

When the system reboots, some customer settings may change back to a previous setting (ex.- navi destination, climate settings, radio station, etc.)

Follow the instructions under Service to aid with this symptom.

*The latest IHU software released **12/2/2019** contains additional stability improvements. Please follow the instructions under Service.

SERVICE:

Do NOT replace the IHU for this symptom unless directed to in a Vehicle Report.

If the above symptom(s) occur, the IHU needs to be upgraded. Please perform a *Total Upgrade* in accordance with TJ 31543.

(The improved IHU software is included in the *Total Upgrade*)

Also make sure any installed in-car apps are of the latest version by checking for updates in the Download Center.

NOTE: If the IHU software has not been upgraded since before May 2017 (i.e. - Center display has old HMI layout per https://volvo.custhelp.com/app/answers/detail/a_id/9837), the in-car apps should be deleted and re-downloaded to the car after the *Total Upgrade*. This is because the apps that worked with the older IHU software are not compatible with the latest IHU software.



If the IHU software and in-car apps all have the latest version and the customer still experiences a **rebooting symptom**: follow the instructions below for retrieving Reset log files from the IHU and attach them to a Vehicle Report following the instructions under Vehicle Report.

Extracting IHU Reset Log Files with VIDA

- A Diagnostic Sequence named *IHU Export Log Files* can be found in VIDA under *Diagnostic Sequences* for the IHU in the *Diagnostics* section.
- Running the diagnostic sequence will give you the option of extracting *Snapshot*, *Reset*, or *All* log files to a USB flash drive.
- Follow the instructions provided and select **“Reset”** - these log files are generated as a result of an IHU reset event.

NOTE: Selecting **“All”** will extract a large number of files from the IHU and will result in excessive file size that can not be attached to a Vehicle Report. **Do not use this option unless instructed to do so in a vehicle report.**

- Once the sequence is completed, the CCD may be blank. At this point turn off the ignition and remove the USB. The CCD should come back on at the next ignition cycle.

If any logs were extracted, they will show up in a folder called “extracted_logs” on the USB drive. Within that folder there will be individual folders for each log. The folder names should look similar to this: **028_20190207140616_R**.

There should only be folders that end with the letter “R” on the USB. Each folder is a log file for an individual reset event.

The extracted log files can be compressed and attached to a Vehicle Report

If VIDA indicates that there are no Reset logs to extract, create a Vehicle Report according to the instructions below and make note of it when contacting the Tech HelpDesk.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area “Vehicle Report” and sub concern area “Support Needed”, use function group 3930.

Ask the customer how frequently this symptom occurs and if any special circumstances are noted in relation to the symptom such as if it only happens during use of certain functions or when using a specific app or source. Include this information in the Vehicle Report.

Compress any log files using file compression software such as WinZip and attach them to the Vehicle Report.