



Preliminary Information

PIT5723 Service Engine Soon (SES) Lamp Illuminated, DTC P1467 and/or P1469 Set

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	2.7L (RPO L3B)	All
Chevrolet	Silverado 1500	2020	All	All	2.7L (RPO L3B)	All
GMC	Sierra 1500 (New Model)	2019	All	All	2.7L (RPO L3B)	All
GMC	Sierra 1500	2020	All	All	2.7L (RPO L3B)	All

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Involved Region or Country	North America
Additional Options (RPO)	
Condition	Some customers may comment that the SES light is on. Dealer may find DTC's P1467 and/or P1469 set in the ECM.
Cause	The EVAP purge pump may be filling with liquid fuel due to customer over filling the fuel tank.

Correction:

If the EVAP purge pump is replaced per diagnostics, please inform the customer not to over fill the fuel tank by more than 3 clicks of a normal filler nozzle as noted in the Owner's Manual.

NOTE: Engineering is currently investigating this concern and the PI will be converted into a bulletin once more information is available.

Version History

Version	1
Modified	12/09/2019 - Created on



GENERAL MOTORS