



Preliminary Information

PIT5724 SES/MIL (Malfunction Indicator Lamp) Illuminated and Communication DTCs Stored

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT4	2019 - 2020	All	All	All	All


Involved Region or Country	North America
----------------------------	---------------

Condition	<p>Some customers may comment that the SES/MIL (Malfunction Indicator Light) light is illuminated at times while driving.</p> <p>Upon a GDS2 scan check, a technician may find one of more of the following DTC's set:</p> <ul style="list-style-type: none"> • B1011 • P175F • P25A2 • U0073 • U0077 • U0114 • U0121 • U0130 • U0131 • U0132 • U0151 • U0159 • U0415 • U0420 • U0452 • U2415
-----------	---

Cause	<p>This condition may be caused by the engine harness (1) chaffing between the power steering gear and the rear of the transmission case (2).</p>
-------	---

Note: This is a multi-wire bundled harness and, depending on which wire is damaged, can set a variety of DTCs.

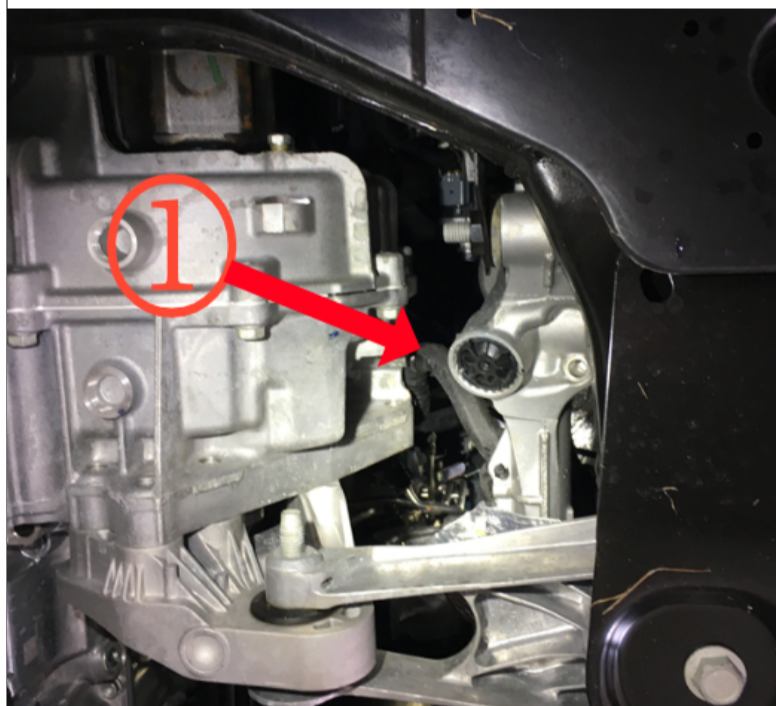

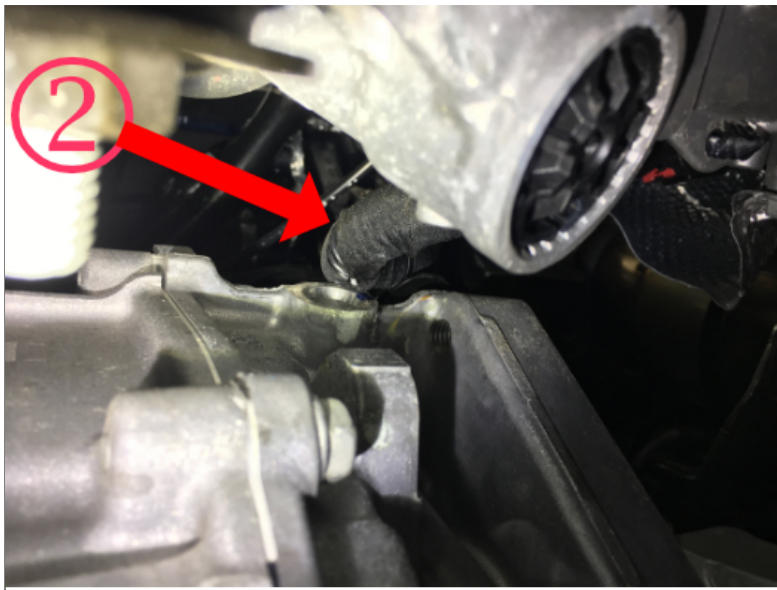

Correction:

To correct this concern, repair the damaged wiring following the SI wire-to-wire repair procedures. Once repaired, protect and reposition the engine wiring harness to prevent future harness damage.

Note: This PI may be converted into a bulletin when new information is available.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	12/11/2019 - Created on



© 2020 General Motors. All Rights Reserved.