



BOL Technical Information

M161 - AM Radio - Poor Reception

Date: 11/12/2019
Bulletin MAS002063
Section: Electrical Systems and
Devices

MASERATI

Models:

M161 MY19 and MY20, production between November 2018 and November 2019 (up to Assembly 6075811).

Description:

Customer complains poor AM reception.

Cause:

The problem could be caused by non-complaint fixing clip of the AM/FM1 Antenna Amplifier. If it is a plastic one, it might not give the proper ground to the Amplifier itself. The correct one is made of metallic material.

Actions:

Inspect the AM/FM1 Antenna Amplifier as shown in Figure 1.

If the fixing clip is plastic one, DO NOT replace AM/FM Amplifier but proceed replacing only the plastic clip with metallic one (PN 673010856).

Should the fixing clip found in the affected Vehicle already be metallic, then further investigation will be required.

Please submit a Blue On Line report as Factory Information for traceability reasons.

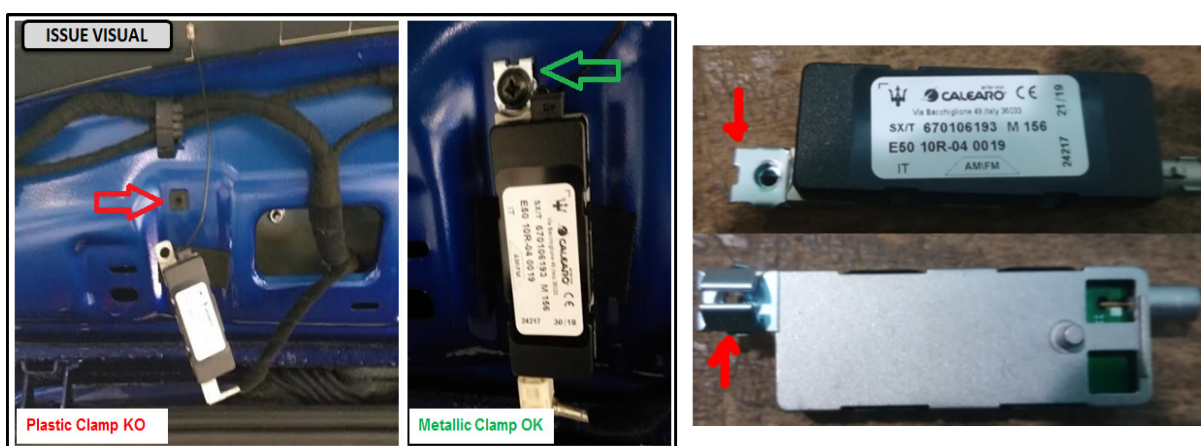


Figure 1. Left: fixing clip of the AM/FM1 Amplifier: left-hand side is plastic one (which is NOT OK), right-hand side is metallic one (which is OK). Right: detail of the metallic fixing clip.