Bulletin No.: PI0791C

Date: Dec-2019

CM CONTROLLED

Service Bulletin

PRELIMINARY INFORMATION

Subject: Accessory Cruise Control Inoperative on Vehicles Without Steering Wheel Controls

Models: 2012-2014 Chevrolet Cruze

Equipped without W1Y or UC3 (Steering Wheel Controls)

This PI has been revised to remove the Warranty Information. Please discard PI0791B.

Condition/Concern

Technicians may find that the accessory cruise control (P/N 95081936) is inoperative after installation and BCM programming is complete.

Important: This condition does not apply to vehicles equipped with W1Y (Steering Wheel Controls) and accessory cruise control package P/N 95081937.

Vehicles equipped without steering wheel controls (W1Y) require steering wheel airbag coil replacement to enable accessory cruise control operation.

Recommendation/Instructions

Installation of the accessory cruise control package (P/N 95081936) also requires the replacement of the steering wheel airbag coil to enable the operation of the accessory cruise control. Refer to Cruise Control Package Installation in the Accessory Installation Manual in SI.

Parts Information

Part Number	Description
22899138 (2012 MY)	Steering Wheel Airbag Coil
22914039 (2013-2014 MY)	Steering Wheel Airbag Coil

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION