

## smart media system, reversing camera inoperative after software update and subsequent SCN coding

---

Topic number	LI54.65-P-069999
Version	2
Function group	54.65 Parking assist
Date	12-19-2019
Validity	BR 453 with smart media system (SA code 556/558/535/557) and reversing camera (SA code 218)
Reason for change	SW 8060 added
Reason for block	

---

### Complaint:

After coding of the multifunction display with software 8056, 8059 (A4539029310), or 8060 (A4539020512), the reversing camera may no longer work.

### Cause:

multifunction display SCN coding

### Remedy:

Perform the following steps:

- Program software 8052 (A4539028800) and perform SCN coding.

The reversing camera should work again

- Install the latest software 8056, 8059, or 8060

- Do NOT perform SCN coding afterwards

All software variants can be found in the XENTRY Portal:

Mercedes-Benz XENTRY Portal home screen -> "Maintenance & repair" -> "Workshop equipment" -> "Downloads & updates" -> "Software updates"

"8059" or "8060" is shown in the multifunction display if the customer software update is performed via the smart website ([www.smart.com/GPS](http://www.smart.com/GPS)).

The software number (A4539029310 or A4539020512) is the same regardless of the source.

See also: LI82.70-P-067315

# XENTRY TIPS

---

Symptoms
Communication/information / Entertainment / Screen/display / Miscellaneous
Communication/information / Assistance and warning systems / Parking assist / Reversing camera / Malfunction
Communication/information / Entertainment / Overall system/system error / System operable/Display faulty
Communication/information / Assistance and warning systems / Parking assist / Reversing camera / Without picture

Control unit/fault code		
Control unit	Fault code	Fault text
A40/3 - Audio/COMAND display (ZAN) (MFD453)	-	-