

Service Bulletin

Bulletin No.: 19-NA-199

Date: December, 2019

INFORMATION

Subject: Information On Poor AM/FM Reception

Brand:	Model:	Model Year:		Breakpoint:		Engino	Transmission:
		from	to	from	to	Engine:	
GMC	Acadia	2020	2020	-	-	-	-

Involved Region or Country	North America, NA Export vehicles
Condition	Some customers may comment on poor AM/FM reception. This condition is primarily noted in fringe areas.
Cause	This condition may be due to a design change for the 2020 model year antenna (mega shark fin) which is inherently inferior relative to AM/FM reception.
Correction	Offer the customer the option of replacing the 2020 model year antenna, with the 2019 model year antenna (hexband/mast) and base. This substitution should improve AM/FM reception. Refer to <i>Radio Antenna Base Replacement</i> in SI.

Parts Information

Causal Part	Description	Part Number	Qty
		23204012	
Х	ANTENNA, HIGH FREQ	23362138	1
	-	23378426	
	ANTENNA, RDO	22969192	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time	
3486948*	Radio Antenna Base and Radio Antenna Replacement	0.5 hrs.	
*This is a unique Labor Operation for Bulletin use only.			

Version	1
Modified	Released December 10, 2019

