



# **Service Memorandum**

## **SM1906 Cummins Fault Codes 3555 And 3556**

**Models Affected:** Certain Vision, All American, and TX4 with Cummins Diesel Engines And With Certain Base ECM Calibrations

**Subject:** Cummins ECM Calibration Update To Reduce Occurrence Of Cummins Fault Codes 3555 And 3556

The intent of Service Memorandum SM1906 is to make Blue Bird Dealers aware that Cummins has released a calibration update improvement to reduce occurrence of “Engine Fault Codes 3555 and 3556” on Cummins diesel engines with the following base ECM calibrations:

"HC80145 thru HC80250"

"HB80104 thru HC80195"

**Engine Fault Code 3555 – Engine Wait to Start Lamp - Abnormal Update Rate**

**Engine Fault Code 3556 – Engine Wait to Start Lamp - Received Network Data in Error**

**Use Cummins INSITE™ to verify Cummins ECM calibration revision installed**

Refer to Cummins QuickServe® to confirm latest Cummins ECM calibration available for the engine serial number (ESN). Insure the latest applicable Cummins ECM calibration is installed.

**Note:** Insure the above listed base ECM calibrations are at revision .10 or higher