



Technical Tip

Topic	01-18-15TT - Radiator Shutter Faults P05A3, P05A0, U0284
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Volkswagen
Date	November 9, 2018

Condition

ATTENTION:**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.****TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Radiator Shutter Faults P05A3, P05A0, U0284

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2019	1.4L (DGXA)	All	All	All
Atlas	2018	3.6L (CDVC)	All	All	All
Passat	2018	2.0L-3.6L (DDSA, CDVB)	All	All	All

Technical Background

NA.

Service

Inspect the shutter for any obstructions that could result in blocking it's movement and remove any obstructions. Test for power and ground at the -**V544**- (Radiator Shutter Motor) 4 pin connector. Repair any concerns found. Reconnect the 4 pin connector and perform the output test (function test). If there were no obstructions, circuitry checks ok and the fault(s) return, replace the complete shutter assembly. Perform -**V544**- basic settings.

Additional Information

Revision History

Revision Number	Released Date	Reason For Update
2052932/1	11/9/18	Original publication.

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.