Technical Tip

Торіс	21-18-02TT - Rattle from the Turbocharger Charge Air Pressure Actuator - V465-		
Market area	United States 444 Volkswagen of America, Inc. (6444)		
Brand	Volkswagen		
Date	November 16, 2018		

Condition

۸т	TC	NITI	
AI			ч.

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN. TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

Rattle from the Turbocharger Charge Air Pressure Actuator - V465-

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta	2016-2017	1.4L (CZTA)	All	AII	All

Technical Background

Turbo charger rattle from the pivot on the waste gate actuator rod.

Service

For rattle noises from the Charge Air Pressure Actuator - **V465**-with no DTC's, check to see if the pivot pin in the actuator rod is loose and causing the rattle. If the rattle goes away when pressure is applied to the pivot pin, use a retaining clip (06J-145-220-A, the same clip that was used on the CCTA turbos) to secure the rod. Part numbers are for reference only. Make certain the parts catalog is referenced to obtain the latest applicable component.

Additional Information

Revision History						
Revision Number	Released Date	Reason For Update				
2052994/1	11/16/18	Original publication.				

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.