

Technical Tip

Topic	69-18-02TT - Airbag Light ON with Fault Codes Stored in Air Bag Control Module - J234 Memory
Market area	United States 444 Volkswagen of America, Inc. (6444)
Brand	Volkswagen
Date	November 2, 2018

Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Airbag Light ON with Fault Codes Stored in Air Bag Control Module -~~J234~~ Memory

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan LWB	2018	All	All	All	All

Technical Background

Customer complaint of airbag light ON, with a fault code stored in memory.

Service

For any airbag control module -~~J234~~ faults, inspect the airbag control module and connector for signs of water intrusion.

If signs of water are found:

- Check HVAC Air box, A.C. drain tube connection and refer to TSB 2052184 for water ingress from the expansion valve boot area.

If water is found in the airbag connector area:

- Repair the source of the leak and replace the airbag module.

If no evidence of water intrusion is found at the airbag control module:

- Continue with the normal GFF diagnosis of the airbag module faults.

Additional Information

Revision History		
Revision Number	Released Date	Reason For Update
2052846/1	11/2/18	Original publication.

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.