



Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan LWB	2018	All	All	All	All
Tiguan LWB	2019	All	All	AX_KM000001	AX_KM019515

Condition

92 18 02 November 6, 2018 **2052810**

Windshield Washer Fluid Leaking

Windshield washer fluid leaking or windshield washer fluid high consumption.

Technical Background

Windshield washer fluid leaks through the reservoir cap due to slushing action while braking.

Production Solution

New windshield washer reservoir cap with seal implemented in production as of VIN: AX_KM019515.



Figure 1 – New Washer Cap



Technical Bulletin

Service

Check if washer cap P/N: **3Q0-955-455** is installed and replaced it with P/N: **3G0-955-455**. See ETKA for the latest part supersession.



Warranty

Information only.

Required Parts and Tools

Part No:	Part Description	Quantity
3G0-955-455 ¹⁾	Sealing Cap	1

Part numbers are accurate at time of publication. Always refer to ETKA for the latest part information.

No special tools required.



Technical Bulletin

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

Document Control Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2052810/1	11/6/18	V921802	Original publication.